


Large digit load / weight indicator / controller

MAGNA 4 or 6-Digit Load Cell


Installation & Operating Manual

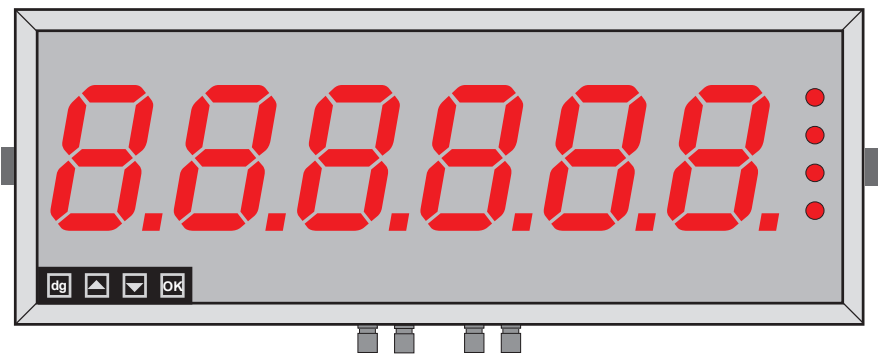

Caution: Risk of electrical shock if this instrument is not properly installed.

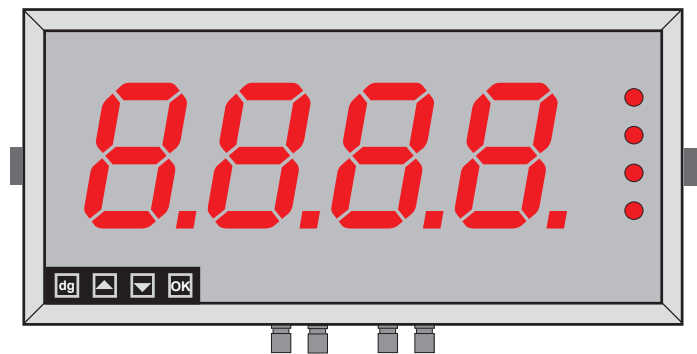

Caution: Read the whole manual before you install this display.

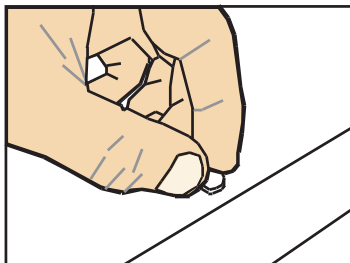

Rear case screws - please note

The rear panel is held in place with finger-screws, which only need to be gently tightened.

Do not use tools to tighten or loosen the screws, as this could cause damage to the internal threads.



LAUREL Electronics, Inc.

3183-G Airway Ave, Costa Mesa, CA 92626, USA

Tel +1 714-434-6131

Fax +1 714-434-3766

www.laurels.com

sales@laurels.com

Warranty

We warrant our products against defects in materials or workmanship for a period of one year from the date of purchase.

In the event of a defect during the warranty period, the unit should be returned, freight (and all duties and taxes) prepaid by the Buyer to the authorised distributor from where the unit was purchased.

The Distributor, at its option, will repair or replace the defective unit. The unit will be returned to the Buyer with freight charges prepaid by the distributor.

LIMITATION OF WARRANTY

The foregoing warranty shall not apply to defects resulting from:

1. Improper or inadequate maintenance by the buyer.
2. Unauthorised modification or misuse.
3. Operation outside the environmental specification of the product.
4. Mishandling or abuse.

The warranty set forth above is exclusive and no other warranty, whether written or oral is expressed or implied. We specifically disclaim the implied warranties of merchantability and fitness for a particular purpose.

EXCLUSIVE REMEDIES

The remedies provided herein are the buyer's sole and exclusive remedies.

In no event shall we be liable for direct, indirect, incidental or consequential damages (including loss of profits) whether based on contract, tort or any other legal theory.

Contents

Warranty	2
Warnings	4
Introduction	5
General Description	6
Suspension Mounting	7
Wall Mounting	8
Panel Mounting	9
Connections	10-11
Installation hints for best performance	12-13
Language Selection	14
Display Brightness	14
Display Calibration Modes	15
Direct Calibration	16-17
Linearisation with Direct Calibration	18-20
Theoretical Calibration	20-21
Linearisation with Theoretical Calibration	22-23
Sensor Drift correction	24
Logic Input functions	25
Logic Input connections & Front Buttons	26
Factory defaults	27
Calibration Audit number	27
Signal Filtering / Averaging (see also page 42)	29-30
Last Digit rounding	30
Scale Factor adjustment	31
Offset Adjustment	32
Menu Timeout adjustment	33
Reverse / Mirror display setting	34
Bootup Routine choices	35
Multi Memory MEM option	36
Error Codes	37
Output Options - installing	38
WEEE	39
Equipment Specifications	40
Record of Revisions	40
Loadcell Connection examples	41
Input board filter configuration	42
Declaration of Conformity	43

Separate manuals for options

Alarm option settings	See Alarm manual *
Analog output option settings	See Analog manual *
Serial output option settings	See Serial manual *
Real Time Clock settings	See Serial manual *

* Need manuals urgently? You can download manuals from our website.

Warnings

Please carefully read this manual and all warnings. Install the display ONLY when you are sure that you've covered all aspects.



Where the product is intended for "UL" installations, removal or addition of option boards is not permitted.



Check that the model number and supply voltage suit your application before you install the display.



Connect the display according to current IEE regulations, IEC61010 & NFPA:70 National Electric Code in USA.



Power supplies to this equipment must have anti-surge (T) fuses rated at 1A for 230V supply, 2A for 110V supply, 5A for 48VAC or 10A for DC supplies in the range 11-30VDC.



Don't touch any circuitry after you have connected the display, because there may be lethal voltages on the circuit board.



Do not apply power to the display if its case is open.




Only adjust on-board switches or connections with the power turned off.



Make sure all screw terminals are tight before you switch the meter on.



Only clean the display's case and window with a soft damp cloth. Only lightly dampen with water. Do not use any other solvents.

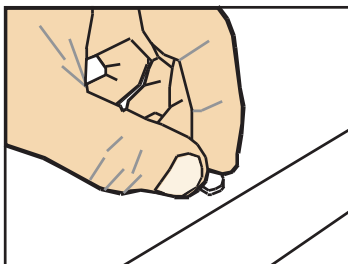

Rear case screws - please note

The rear panel is held in place with finger-screws, which only need to be gently tightened.

Do not use tools to tighten or loosen the screws, as this could cause damage to the internal threads.

Introduction

Please contact us if you need help, if you have a complaint, or if you have suggestions to help us improve our products or services.

If you contact us about a product you already have, please tell us the full model number and serial number, so that we can give you accurate and fast help.

This product has a 3 year warranty. We will put right or replace any display which is faulty because of bad workmanship or materials. This warranty does not cover damage caused by misuse or accident.

If you return a unit for repair, please include a detailed description of the problem, and the name of a contact who we can refer to for any questions. Please mark for the attention of the QA Department.

IMPORTANT

If this equipment is important to your process, you may want to buy a spare to cover possible failure or accidental damage in the future.

This is because during factory shutdown periods, you may have to wait several weeks for an equivalent replacement, or we may have no stock at the time you urgently need it.

You may also need to pay extra carriage charges if you want a fast, guaranteed courier service. Warranty repairs or replacements are usually returned with a standard courier service.

We do not offer compensation for losses caused by failure of this instrument.

If you do not agree with these conditions, please return this item in unused condition, in its original packaging and we will refund the purchase price, excluding any carriage paid.

We thought you'd prefer to know about possible delays and extra charges now, rather than during a panic. A spare unit could help to avoid these issues.

We always try to improve our products and services, so these may change over time. You should keep this manual safely, because future manuals, for new designs, may not describe this product accurately.

We believe these instructions are accurate, and that we have competently designed and manufactured the product, but please let us know if you find any errors.

General Description

This series of displays accepts industrial sensors to allow various physical measurements to be made, such as weight, temperature, pressure, humidity etc. Different models are available for different sensor types.

The main function of this series is to give a clear numeric readout of the variable being monitored. Most models include an excitation power output, to power the sensor directly.

Various digit heights are available, to suit the maximum viewing distance required in each installation. For every 10 metres of viewing distance required, use 1" of digit height.

Various optional output modules are also available to give alarm relay outputs, analogue output or digital communications, or any combination of these options.

Displays are programmed using front panel pushbuttons. The front panel buttons can be disabled. In addition, you can connect 4 remote wired pushbuttons to the display, so that you can make adjustments while the display is mounted in an inaccessible location.

Power supply options : 100-240 VAC, 48VAC or 11-30VDC

These displays must be installed fully assembled, and must be installed according to local electrical installation rules.

When properly installed, and provided they have been ordered with cable glands exiting the lower surface of the case, they provide ingress protection to IP65 / NEMA4X from all directions.

Safety



Caution: There is a risk of electrical shock if this display is not properly installed




Caution: Risk of danger: Read the whole manual before you install this display


Obey all safety warnings in this manual, and install the display according to local wiring and installation regulations. Failure to follow these guidelines may cause damage to the display, connected equipment, or may be harmful to personnel.

Any moving mechanical device controlled by this equipment must have suitable access guards to prevent injury to personnel if the display should fail.

Suspension Mounting Dimensions

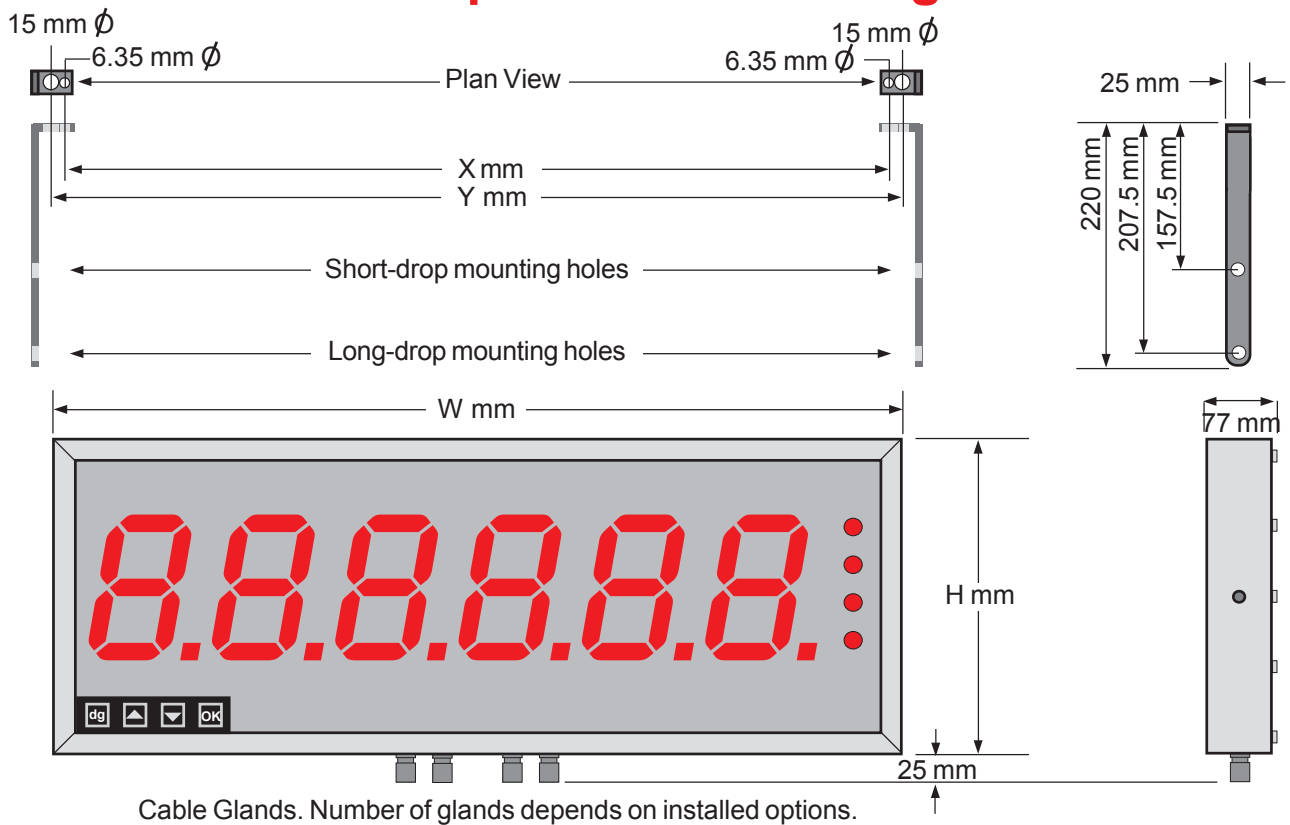

Detail showing bracket hardware fitting sequence

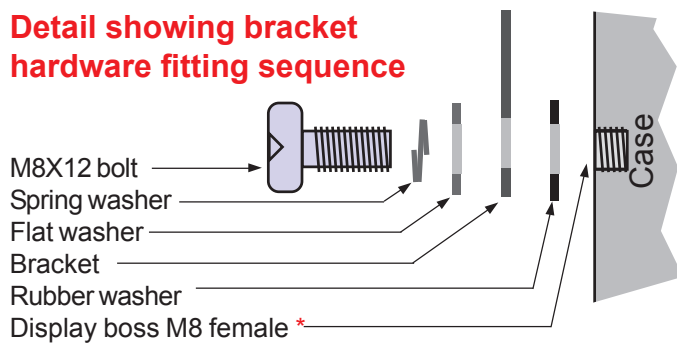


You can order these displays with the cable glands in the bottom surface (as shown) the rear, or top. Rear glands allow you to mount the display on top of a cubicle, using the brackets shown.


*** Do not use longer bolt threads than 12 mm , or you will fracture the female boss, and the case will no longer be sealed.**

Display Format	X mm	H mm	W mm	Y mm
2" 4 digit clock	245	154.5	291	275
2" 4 digit numeric	233.5	154.5	279.5	263.5
2" 6 digit clock	354	154.5	400	384
2" 6 digit numeric	330	154.5	376	360
4" 4 digit clock	407	195.5	453	437
4" 4 digit numeric	388	195.5	434	418
4" 6 digit clock	607	195.5	653	637
4" 6 digit numeric	570	195.5	616	600
6" 4 digit	534	246	580	564
6" 6 digit	774	246	820	804
8" 4 digit	704	290	750	734
8" 6 digit	1026	290	1072	1056
12" 4 digit	1004	408	1050	1034
12" 6 digit	1494	408	1540	1524
16" 4 digit	1322	515	1368	1352
16" 6 digit	1974	515	2020	2004

Wall Mounting Dimensions

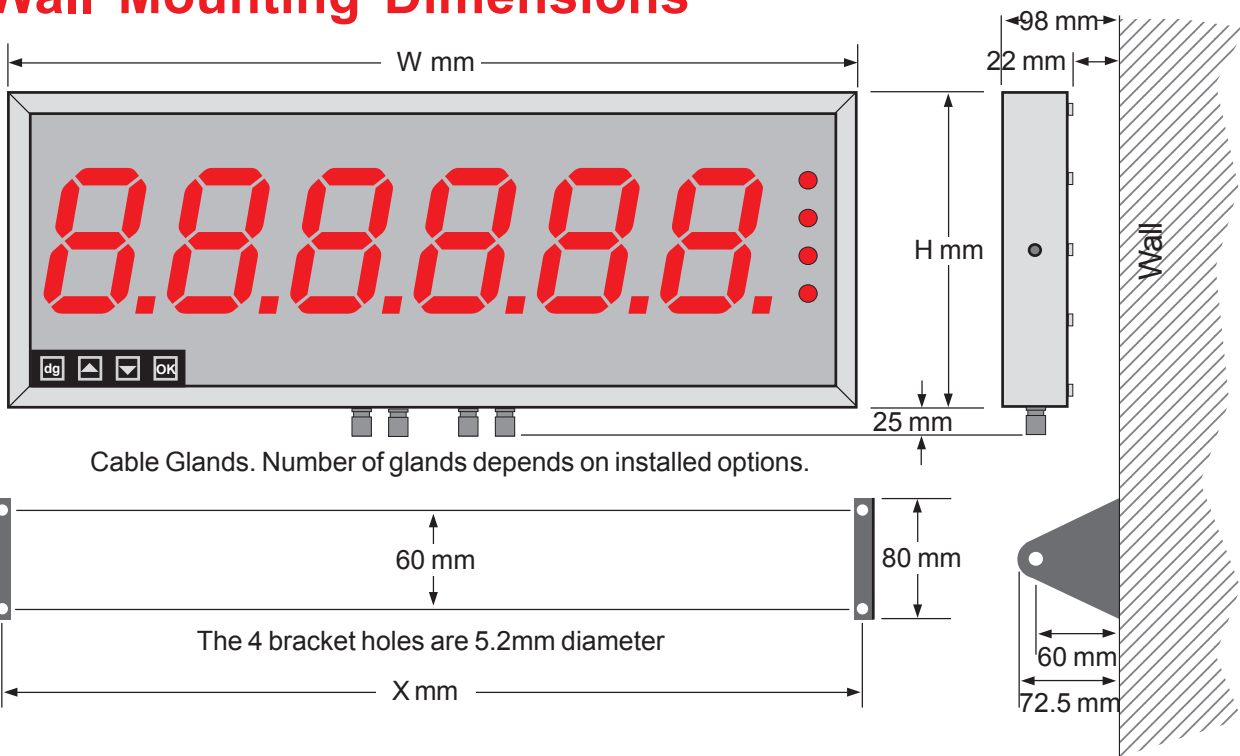

Detail showing bracket hardware fitting sequence

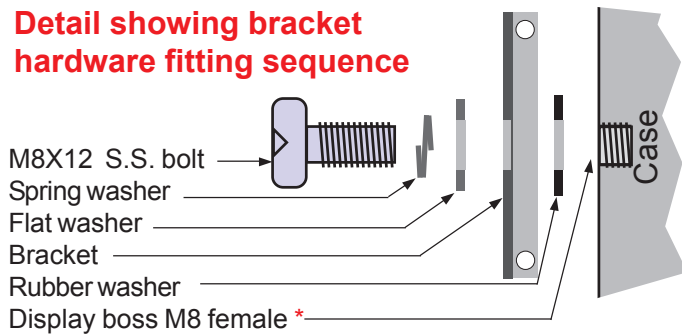


You can order these displays with the cable glands in the bottom surface (as shown) the rear, or top. Rear glands allow you to mount the display on top of a cubicle, using the brackets shown.

*** Do not use longer bolt threads than 12mm , or you will fracture the female boss and the case will no longer be sealed.**


Display Format	X mm	H mm	W mm
2" 4 digit clock	278	154.5	291
2" 4 digit numeric	266.5	154.5	279.5
2" 6 digit clock	387	154.5	400
2" 6 digit numeric	363	154.5	376
4" 4 digit clock	440	195.5	453
4" 4 digit numeric	421	195.5	434
4" 6 digit clock	640	195.5	653
4" 6 digit numeric	603	195.5	616
6" 4 digit	567	246	580
6" 6 digit	807	246	820
8" 4 digit	737	290	750
8" 6 digit	1059	290	1072
12" 4 digit	1037	408	1050
12" 6 digit	1527	408	1540
16" 4 digit	1355	515	1368
16" 6 digit	2007	515	2020

Panel mounting dimensions

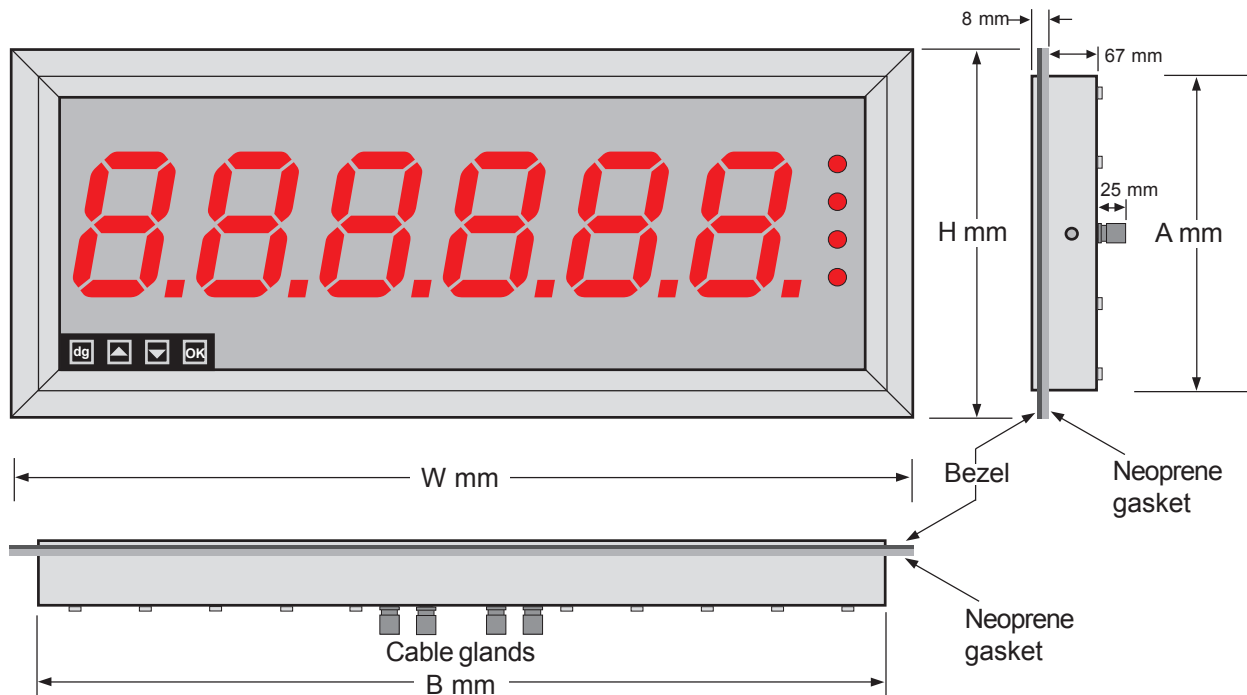

Detail showing bracket hardware fitting sequence


Panel cutout dimensions
 $A + 3 \text{ mm (h)} \times B + 3 \text{ mm (w)}$

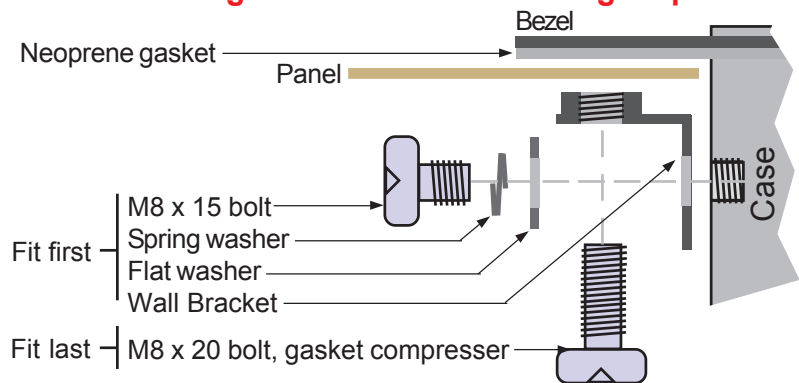

Display Format	H mm	A mm	B mm	Wmm
2" 4 digit clock	172.5	154.5	291	309
2" 4 digit numeric	172.5	154.5	279.5	297.5
2" 6 digit clock	172.5	154.5	400	418
2" 6 digit numeric	172.5	154.5	376	394
4" 4 digit clock	213.5	195.5	453	471
4" 4 digit numeric	213.5	195.5	434	452
4" 6 digit clock	213.5	195.5	653	671
4" 6 digit numeric	213.5	195.5	616	634
6" 4 digit	264	246	580	598
6" 6 digit	264	246	820	838
8" 4 digit	308	290	750	768
8" 6 digit	308	290	1072	1090
12" 4 digit	426	408	1050	1068
12" 6 digit	426	408	1540	1558
16" 4 digit	533	515	1368	1386
16" 6 digit	533	515	2020	2038

Connections


There is a wide range of possible locations for the input board, output board and power supply board/s. Their locations depend on the height of digits, number of digits, brightness of digits and any installed options. Because the permutation of possible locations is large, we will not describe the location of boards within the display, but simply identify the connectors and their functions on each board, below ...

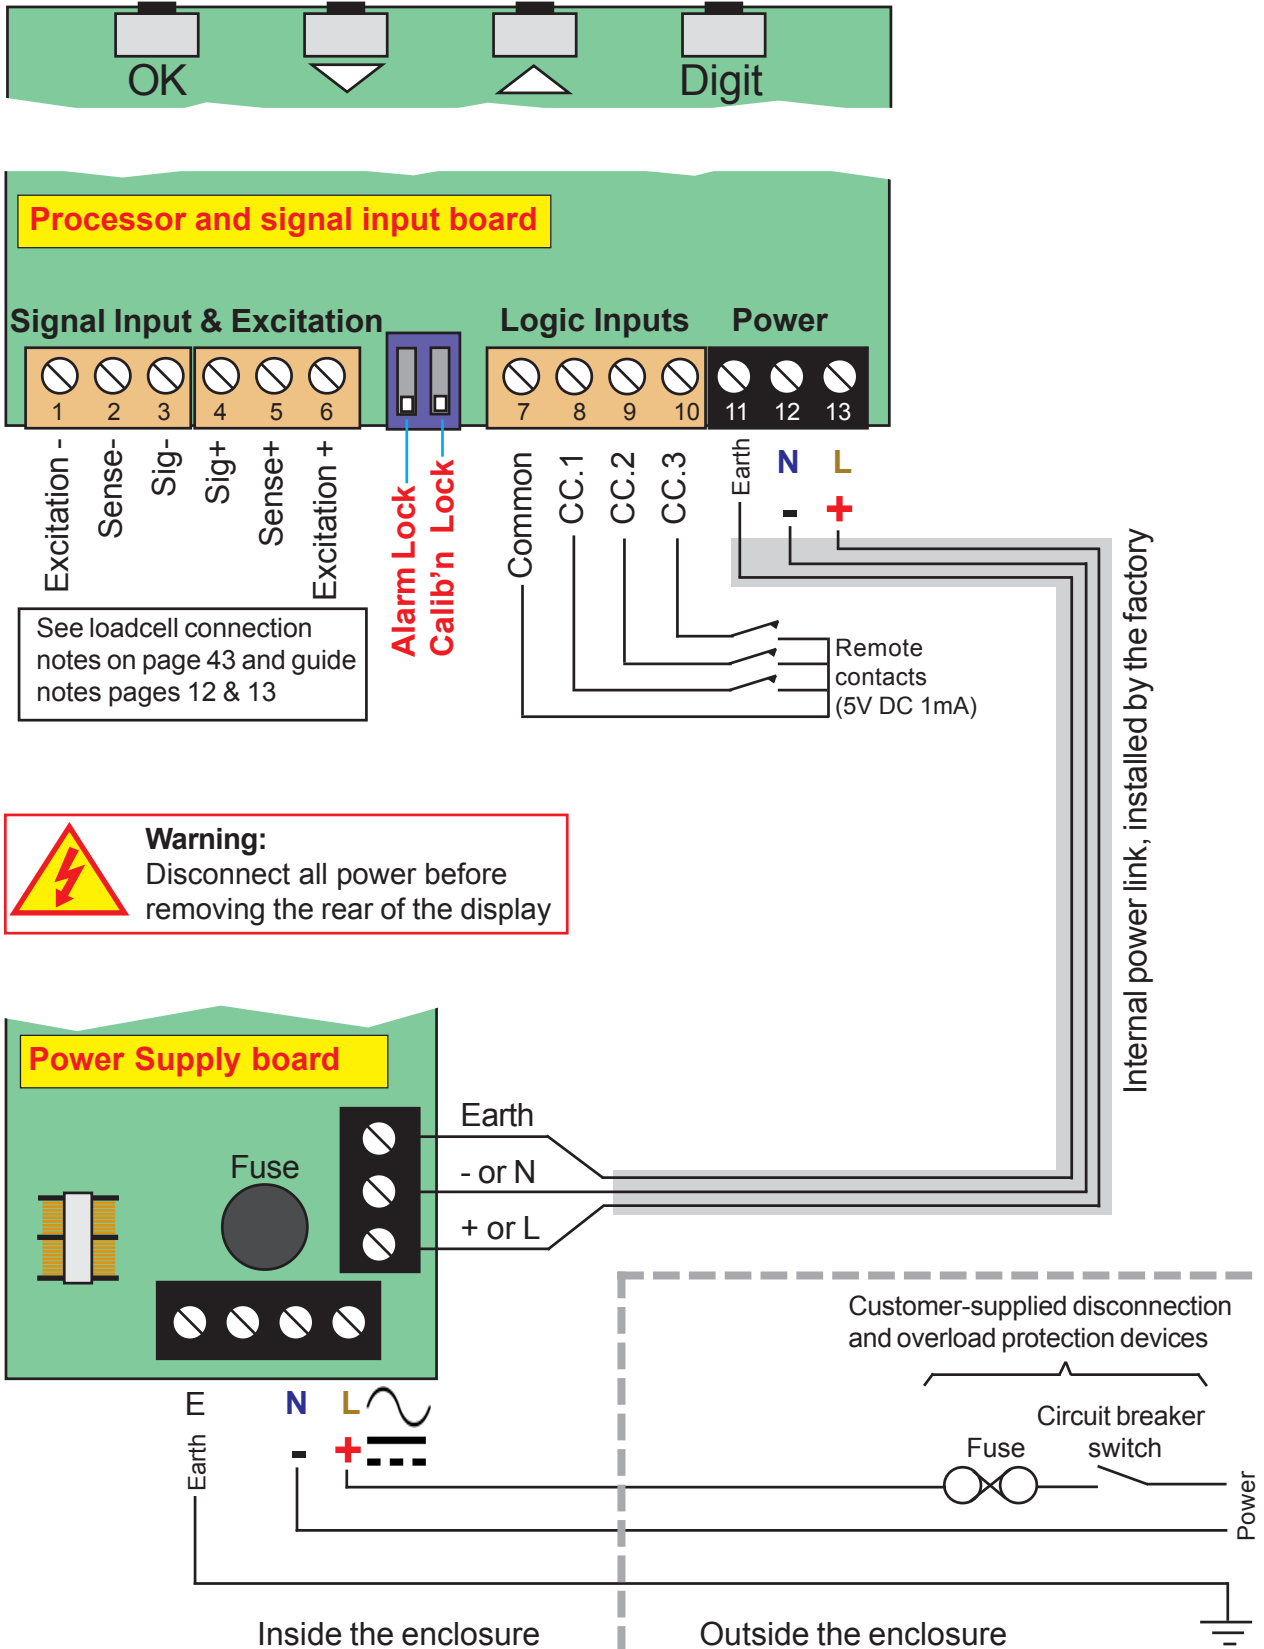

Connections

Warning:
Disconnect all power before removing the rear of the display



Connectors and options
Connectors may be present even if output options are not installed. Refer to rating label to see installed options.

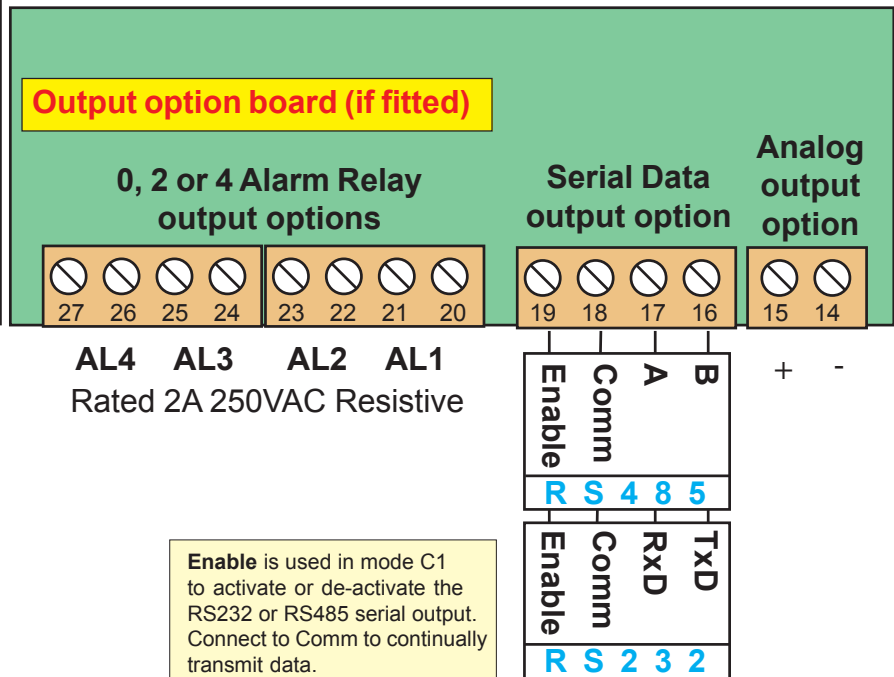

Remote programming button connector

On one of the display boards, you will find a 7 way connector, to which you can wire remote programming buttons, to allow adjustment of the display's settings when the display is inaccessible.

You can also enable or disable the display's front panel buttons, either by a remote contact closure, or by an on-board push-on jumper switch, which is located near to the remote button connector. When the contact is closed, or the push-on switch fitted, the front buttons are enabled.

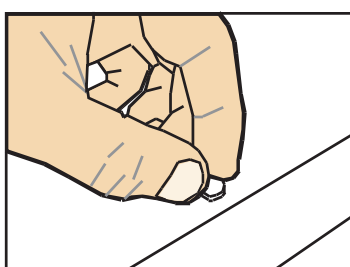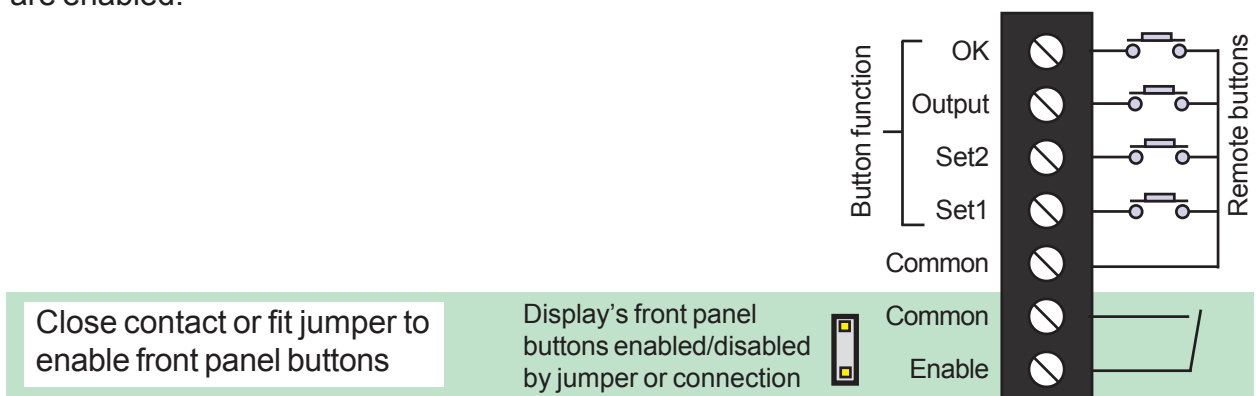

Rear case screws - please note

The rear panel is held in place with finger-screws, which only need to be gently tightened.


Do not use tools to tighten or loosen the screws, as this could cause damage to the internal threads.



Installation Hints for Best Performance

This section offers several suggestions which will help you get the best performance from your weighing system.

Loadcells create very small signals which can easily be corrupted by electrical noise. These steps will ensure you get the best possible performance from your meter.

1. Use good quality screened signal cable, with 3 twisted pairs. Belden 8777NH, Belden 9503 and AlphaWire 6010C are good choices, available from many electrical distributors.
2. Even if your loadcell is only a 4 wire device, we recommend you use 6 core cable between the display and the loadcell, and wire as shown in the diagram opposite. This will ensure that any resistance changes in your cabling, caused by changes in temperature, will be cancelled.
3. Each pair should be dedicated to a signal function as shown opposite, for maximum noise immunity. (One twisted pair for Excitation, one twisted pair for Sense, one twisted pair for Signal) This will ensure that any electrical noise induced in the cable is properly cancelled. Mixing functions carelessly amongst the twisted pairs can actually worsen noise performance.
4. The cable should be routed away from noisy wiring and devices such as power feeds from inverters, discharge-lighting cables, welder cabling etc, and should preferably be routed in a dedicated low voltage signalling/instrumentation conduit or cable tray.
5. Screened cable should be earthed at the display end only.
6. All wires and screens coming out of the screened cable should be kept as short as possible to minimise pickup of noise.
7. If you are using barriers, you should earth your screen as shown below, paying particular care that you do not earth both ends of any run of of cable. **NB** If using galvanic isolation barriers, connect 10K from terminal 2 to terminal 3 and 10K from terminal 3 to terminal 5 on the display's Sig. Input connector to maintain the input signal within the common mode range of the excitation sense circuit.

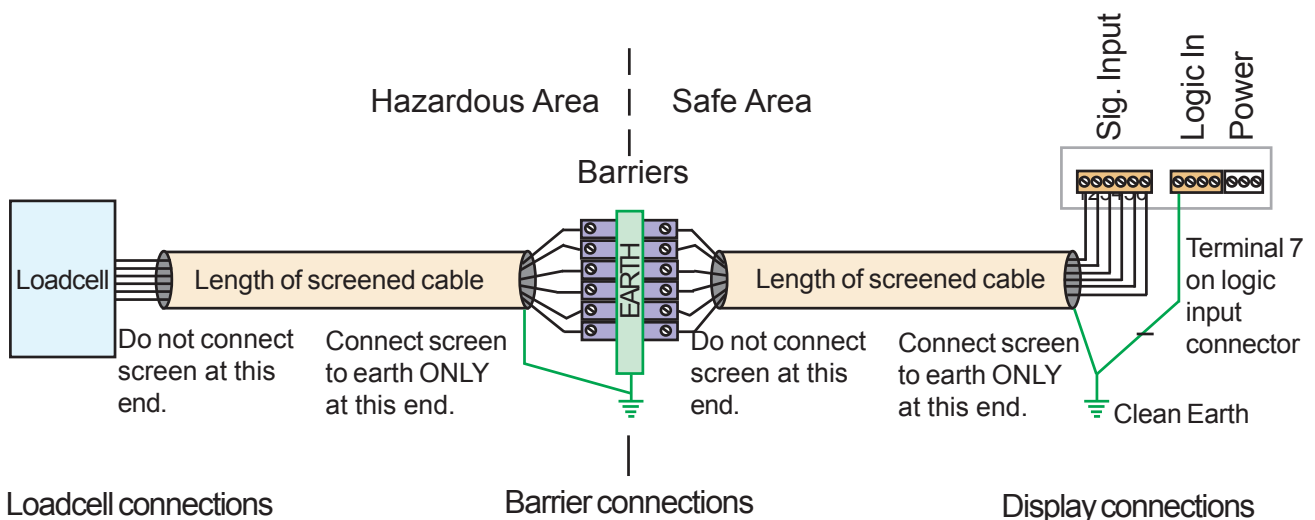

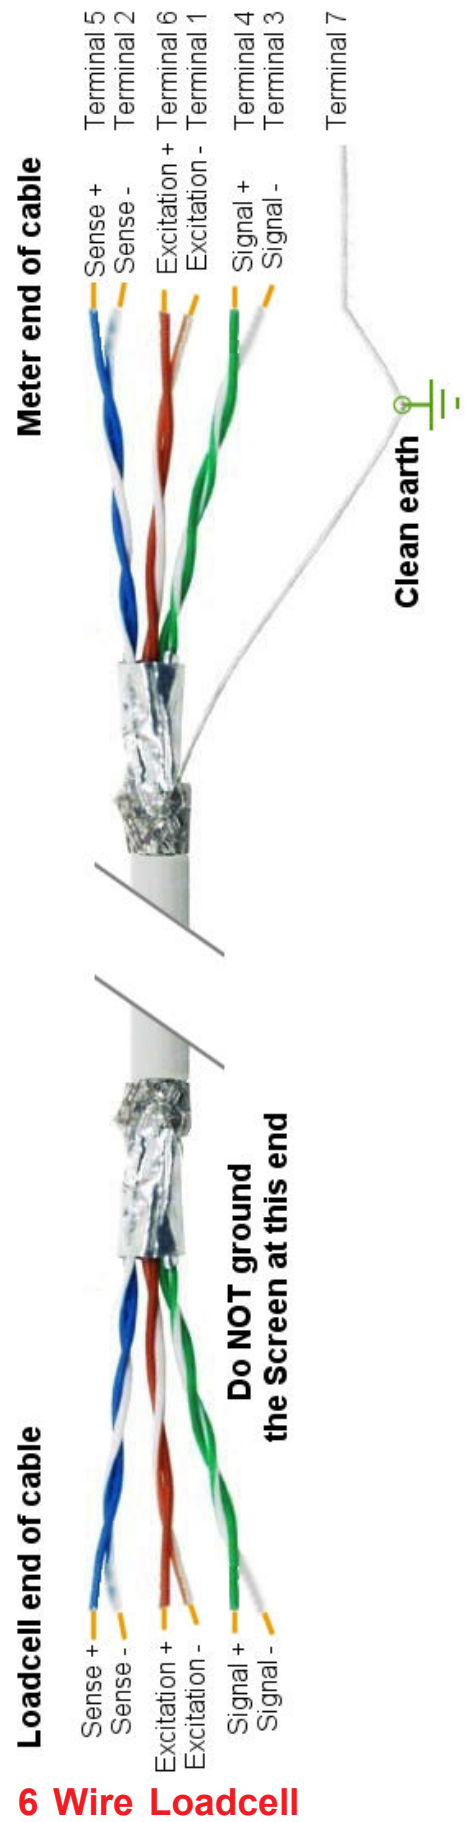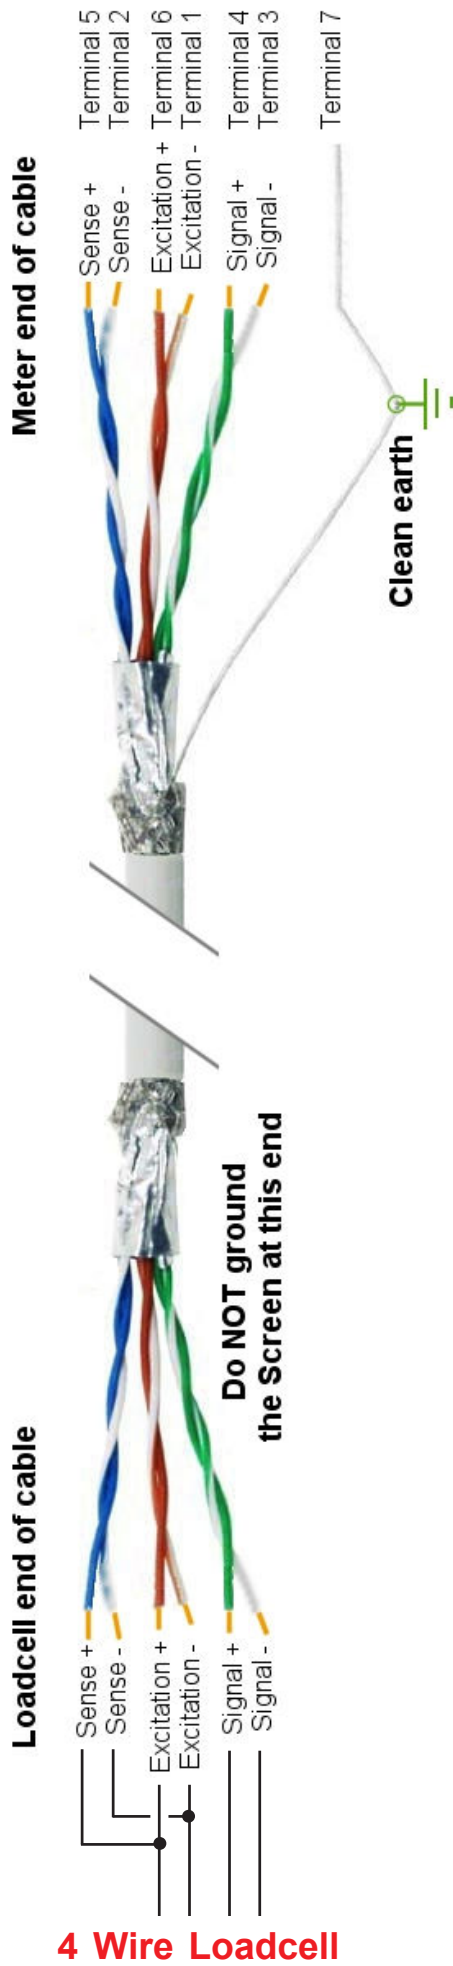

Language Selection for User Interface

1

Set1 Digit Set2 Max/Min Output Alarms

Lockout Switch must be OFF

OFF ON

Circuit board ON

Press together, briefly

2

Set1 Digit Set2 Max/Min Output Alarms OK

Press to toggle

For 4 digits: **L.E.n** for English or **L.F.r** for French.
For 6 digits: **U ! E.n** for English or **U ! F.r** for French.
(Default = English)

3

Set1 Digit Set2 Max/Min Output Reset Alarms OK

Press to accept

Done!

Display Brightness

You can adjust the display brightness at any time, provided the display is locked.

1

Set1 Digit Set2 Max/Min Output Reset Alarms OK

Lockout Switch must be ON

OFF ON

Circuit board ON

Press 3 seconds

2

Set1 Digit Set2 Max/Min Output Reset Alarms OK

Press for 3 seconds

For 4 digits, display shows **br .L**
For 6 digits, display shows **br .9ht**
Each press of the UP button selects a new brightness level. There are 7 brightness levels to choose from.
(Default = Full brightness)

3

Set1 Digit Set2 Max/Min Output Reset Alarms OK

Press to accept

Done!


Meter Calibration Modes


You can choose from two main calibration methods.


1. Direct Calibration - this is when you connect the meter to your system and make the meter read what you want it to, at 2 different points. *This is the preferred calibration method, because it allows you to calibrate the system as a whole.*

2. Theoretical Calibration - this is when you type in the sensor's theoretical signal level at the bottom and top of its range and then type in the value the display should show, for each signal level.

How to choose a calibration method:-

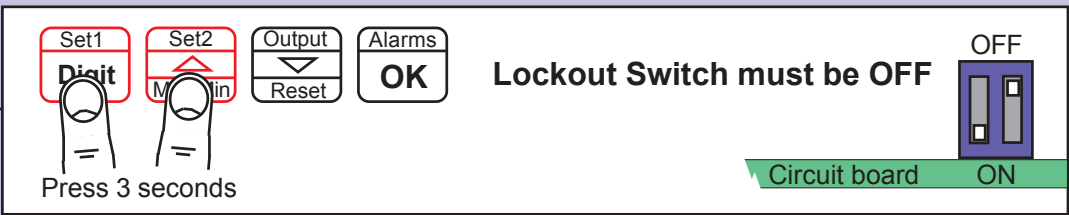1 — **Lockout Switch must be OFF**

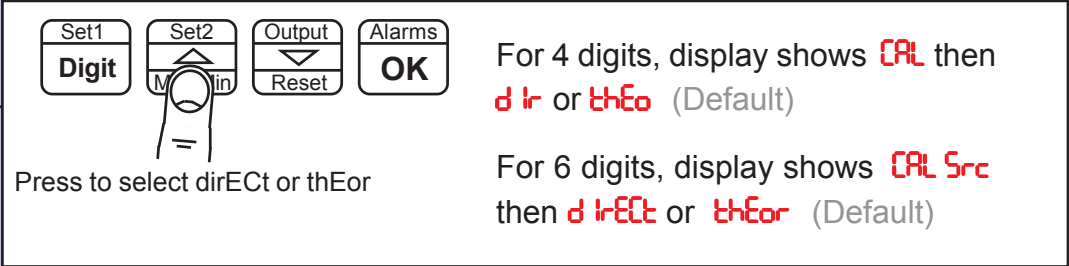2 — **For 4 digits, display shows CAL then dir or thEo (Default)**
For 6 digits, display shows CAL Src then dirECT or thEor (Default)

3 — **Done!**

Direct Calibration - Full Scale Setting


This is when you connect the meter to your system and make the meter read what you want it to, at 2 different points. *This is the preferred calibration method, because it allows you to calibrate the system as a whole.*

How to do direct calibration:-

If you have not done so before, please select Direct Calibration mode from the previous page.

First we recommend you set the **FULL SCALE** calibration ...

1

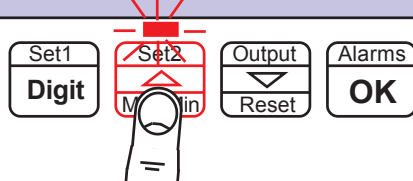


Press 3 seconds


Lockout Switch must be OFF

For 4 digits, display shows **d r** followed by **Set1**

For 6 digits, display shows **d r E C t** followed by **Set H**




2

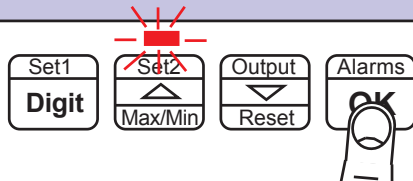

Apply the highest calibration signal you can achieve, ideally 100% of system capacity. You can use less, but you will get better accuracy with higher signals. Then press OK


3

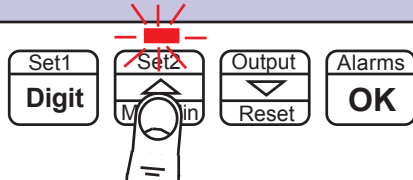

Press for 3 seconds


Press Set2 for 3 seconds. You can now set your decimal point position using the UP or DOWN buttons. Press OK when done.

4

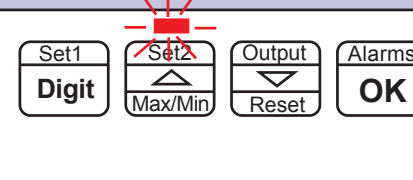


You can now set the display value you want to see - use DIGIT to select each digit in turn, and the UP or DOWN arrow to increase or decrease each digit's value, as required.

5

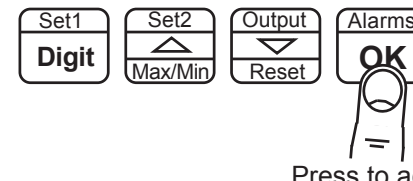

Press to accept




Done!

Direct Calibration - Zero Setting

How to calibrate the **ZERO** point.


- 1**

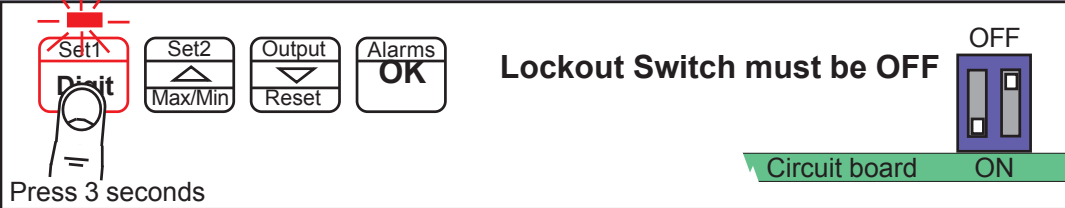

Press 3 seconds


Lockout Switch must be OFF

Circuit board ON
- 2**

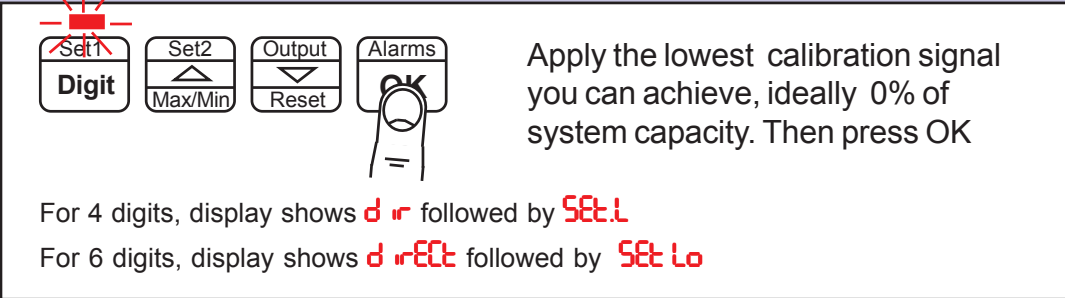


Apply the lowest calibration signal you can achieve, ideally 0% of system capacity. Then press OK

For 4 digits, display shows **d r** followed by **Set L**
For 6 digits, display shows **d r e c t** followed by **Set Lo**
- 3**

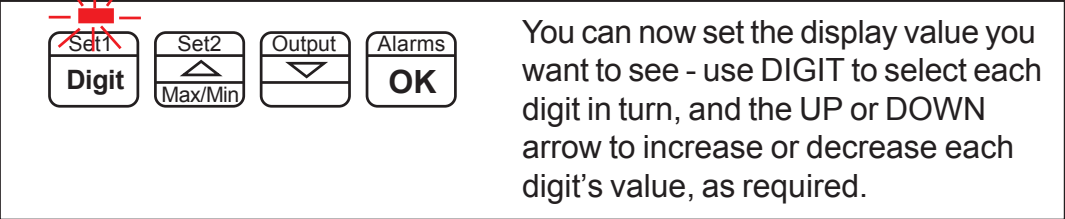

You can now set the display value you want to see - use DIGIT to select each digit in turn, and the UP or DOWN arrow to increase or decrease each digit's value, as required.
- 4**

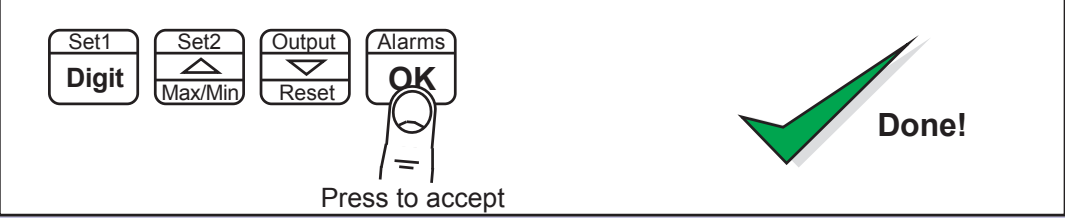

Press to accept

Done!

You can set Zero first, if you prefer, but you will not be able to change the decimal point position in the ZERO calibration step.

This will not be an issue if your zero calibration reading is 0, but may become confusing otherwise.

When you have finished your calibration, please remember to put the calibration lockout switch in its ON position, to protect your settings.

Linearization with Direct Calibration

If your system is nonlinear, you can calibrate the meter and correct for this with the linearizer function.

You will need to apply a series of known loads, starting at 0 and working up to full scale. You will then tell the meter what it should read for each applied load. You can use up to 10 points.

First, you must select Direct Calibration Mode (see page on calibration Modes)
Then, proceed as shown below...

1

Set1
Digit

Set2
N \uparrow
Min


Output
 ∇
Reset

Alarms
OK

Lockout Switch must be OFF

For 4 digits, display will show
L n. 1 or **L n. 0** (Default)

For 6 digits, display will show
L n. 0n or **L n. 0FF** (Default)



Press together, briefly

2

Set1
Digit

Set2
N \uparrow
Min

Output
 ∇
Reset

Alarms
OK

If the display shows **L n. 0** (4 digits) or
L n. 0FF (6 digits), press Set2 button briefly
so that the display shows **L n. 1** (4 digits)
or **L n. 0n** (6 digits), then press OK.

3

Set1
Digit

Set2
Max/Min

Output
 ∇
Reset

Alarms
OK

The display will show **SE. 00** (4 digits) or
SEt 00 (6 digits). Ensure that no load is
applied to the system and press OK.

The display will now show **rd 00**. You can
now tell the meter what it should display for
this load.

Select each digit in turn with the DIGIT button, and increase or decrease
each digit's value using the UP or DOWN button, until the display is set
as required.

You can set the **Decimal Point** position by pressing the Set 2 button for
3 seconds. All decimal points will illuminate, but one will brighter than the
others. Use the UP/DOWN buttons to choose a decimal point position
and then press OK.

4

Set1
Digit

Set2
N \uparrow
Min

Output
 ∇
Reset

Alarms
OK


The display will show **Ad.Pt** (4 digits) or
Add.Pt (6 digits). Press OK.

Continued ...

Linearization with Direct Calibration - cont'd.



5

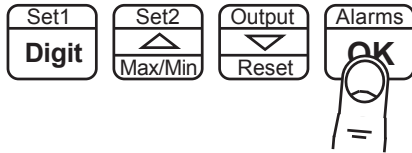


The display will show **SE.0!** (4 digits) or **SEt 0!** (6 digits). Apply your 1st known load to the system and press OK.

The display will now show **rd0!** (4 or 6 digits). You can now tell the meter what it should display for this load.

Select each digit in turn with the DIGIT button, and increase or decrease each digit's value using the UP or DOWN button, until the display is set as required. Press OK when done.

6

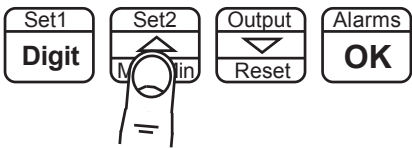



The display will show **rd.Pt** (4 digits) or **rd.Pt** (6 digits).

Press OK if you want to add another calibration point,. You will repeat the previous steps, each time incrementing "Set XX" and "rd XX" up to Set 09 and rd 09, which are the last available points.

If you want to finish adding points, press Set2 until the display shows **SAVE**, and then confirm by pressing OK

If you want to abort the setup, press Set2 until the display shows **Quit** and then press OK

7

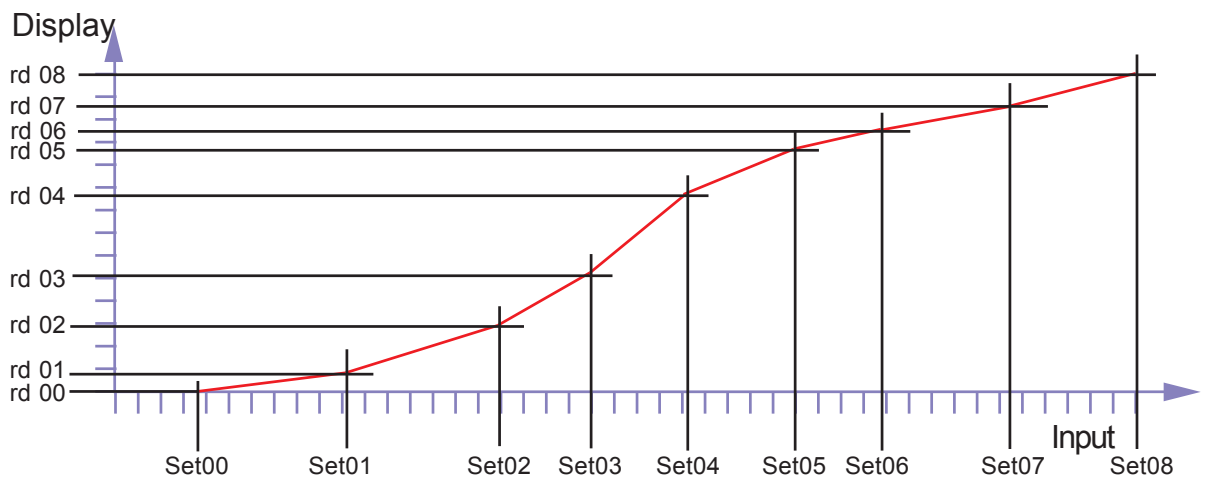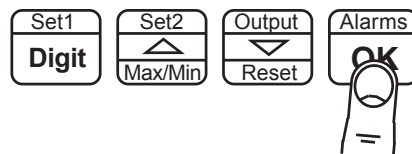

Theoretical Cal. - Decimal Point & Full Scale

This is when you type in the sensor's theoretical signal level at the top and bottom of its range and the value to display, for each signal level.



If you have not done so before, please select Theoretical Calibration mode from the **Meter Calibration** page AND choose whether your input is current or voltage.

First we recommend you set the **FULL SCALE** calibration ...

1


Set1
Digit

Set2
Max/Min

Output
Reset

Alarms
OK

Lockout Switch must be OFF



OFF

Circuit board ON

Press 3 seconds

2

Set1
Digit

Set2
Max/Min

Output
Reset

Alarms
OK

Display shows **thEo** (4 digits) or **thEor** (6 digits).

3

Set1
Digit

Set2
Max/Min

Output
Reset

Alarms
OK

You can now specify the maximum input signal. Use DIGIT to select each digit in turn, and the UP or DOWN arrow to increase or decrease each digit's value. Eg., set **20.00** (4 digits) or **20.0000** (6 digits) if your high input is 20 mV.

Press to accept

4

Set1
Digit


Set2
Max/Min

Output
Reset

Alarms
OK

Display now shows **rdH.** briefly. You can now specify the maximum reading and decimal point position. Press Set2 button for 3 seconds to set decimal point position. Use up and down arrows to move the decimal point and press OK when done. Then, use DIGIT to select each digit in turn, and the UP or DOWN arrow to increase or decrease each digit's value, as required. Set **100.0** (4 digits) or **100.000** (6 digits) if your high end is 100.

Press to accept




Done!


Theoretical Calibration - Low End Calibration


This is when you type in the sensor's theoretical signal level at the top and bottom of its range and the value to display, for each signal level.


If you have not done so before, please select Theoretical Calibration mode from the **Meter Calibration** page.

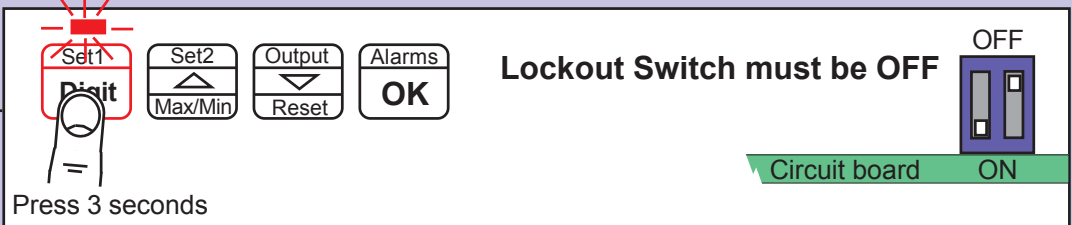
- 

1 Lockout Switch must be OFF

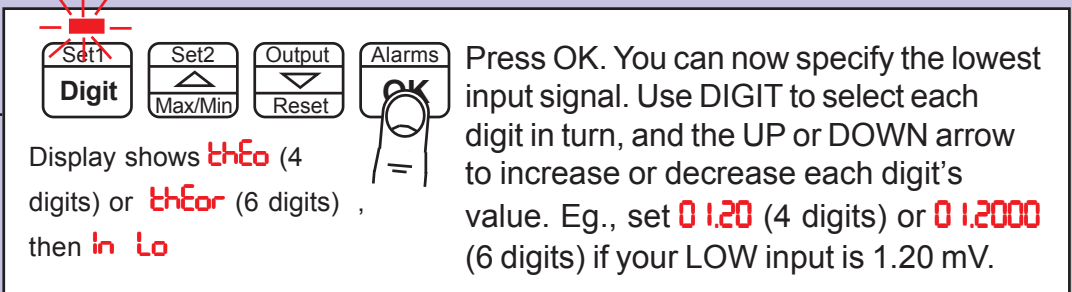Press 3 seconds
- 

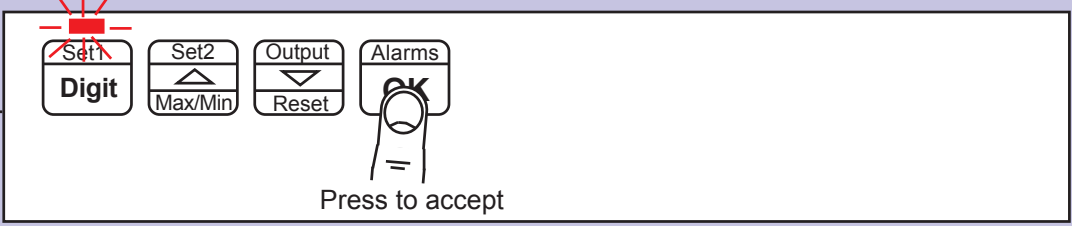2 Press OK. You can now specify the lowest input signal. Use DIGIT to select each digit in turn, and the UP or DOWN arrow to increase or decrease each digit's value. Eg., set **0 1.20** (4 digits) or **0 1.2000** (6 digits) if your LOW input is 1.20 mV.
- 

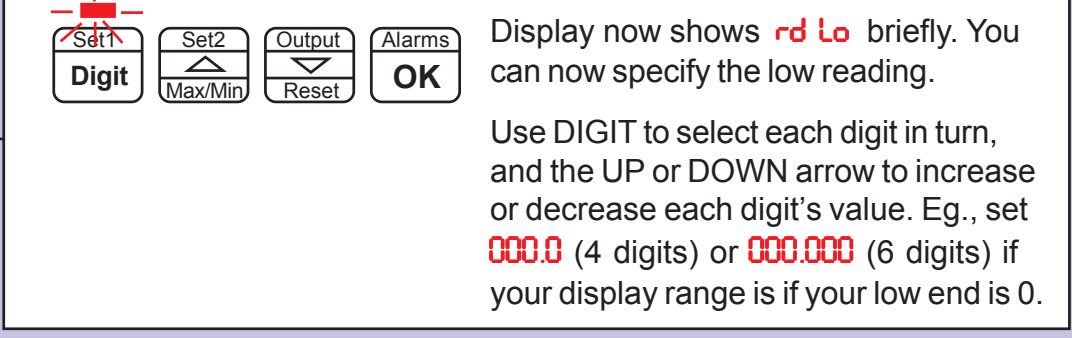3 Press to accept
- 

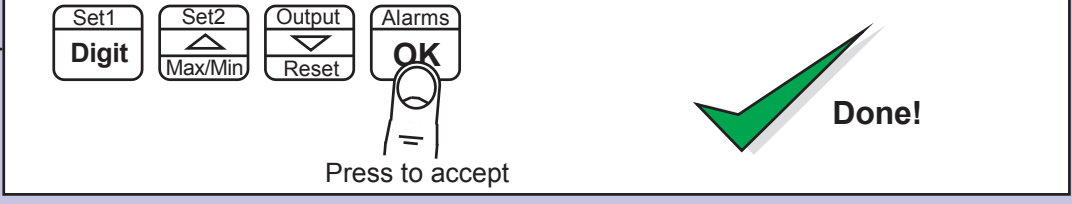4 Display now shows **rd Lo** briefly. You can now specify the low reading. Use DIGIT to select each digit in turn, and the UP or DOWN arrow to increase or decrease each digit's value. Eg., set **000.0** (4 digits) or **000.000** (6 digits) if your display range is if your low end is 0.
- 

5 Press to accept

Done!

You can set Zero first, if you prefer, but you will not be able to change the decimal point position in the ZERO calibration step. This will not be an issue if your zero calibration reading is 0, but may become confusing otherwise.

Linearization with Theoretical Cal.

If your system is non linear, you can calibrate the meter and correct for this with the lineariser function.

With this method, you can enter theoretical values for input signal and display values, without having to connect a sensor.

First, you must select Theoretical Calibration Mode (see page on calibration Modes) Then, proceed as shown below...

1

Set1
Digit

Set2
Max/Min


Output
Reset

Alarms
OK

Lockout Switch must be OFF

Display will show **L n. 1** or **L n. 0** (4 digits), or **L n. 0n** or **L n. OFF** (6 digits)

OFF



Press together, briefly

2

Set1
Digit

Set2
Max/Min

Output
Reset

Alarms
OK

If the display shows **L n. 0** or **L n. OFF** , press Set2 button briefly so that the display shows **L n. 1** or **L n. 0n**, then press OK.

3

Set1
Digit

Set2
Max/Min

Output
Reset

Alarms
OK

The display will show **ln 00** followed by an editing screen. Here you can enter your first calibration input signal level using DIGIT button to select each digit in turn. Increase or decrease the value of each digit using the UP or DOWN buttons. Press OK when set.

The display will now show **rd 00**. You can now tell the meter what it should display for this input signal.

Select each digit in turn with the DIGIT button, and increase or decrease each digit's value using the UP or DOWN button, until the display is set as required. Press OK when done.

4

Set1
Digit

Set2
Max/Min

Output
Reset


Alarms
OK

Display will show **Ad.Pt** (4 digits) or **Ad.Pt** (6 digits). Press OK.

Continued ...

Linearization with Theoretical Cal. - cont'd.

5

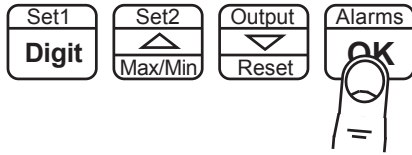


The display will show **In 0!** followed by an editing screen. Here you can enter your next calibration input signal level using DIGIT button to select each digit in turn. Increase or decrease the value of each digit using the UP or DOWN buttons. Press OK when set.

The display will now show **rd 0!**
You can now tell the meter what it should display for this input signal.

Select each digit in turn with the DIGIT button, and increase or decrease each digit's value using the UP or DOWN button, until the display is set as required. Press OK when done.

6

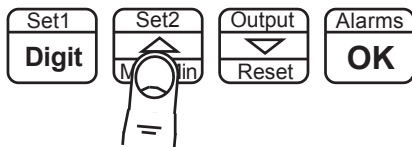


The display will show **rd Pt** (4 digits) or **Add Pt** (6 digits).

Press OK if you want to add another calibration point. You will repeat the previous steps, each time incrementing **In XX** and **rd XX** up to In 09 and rd 09, which are the last available points.

If you want to finish adding points, press Set2 until the display shows **SAVE**, and then confirm by pressing OK.

If you want to abort the setup, press Set2 until the display shows **Quit** and then press OK.

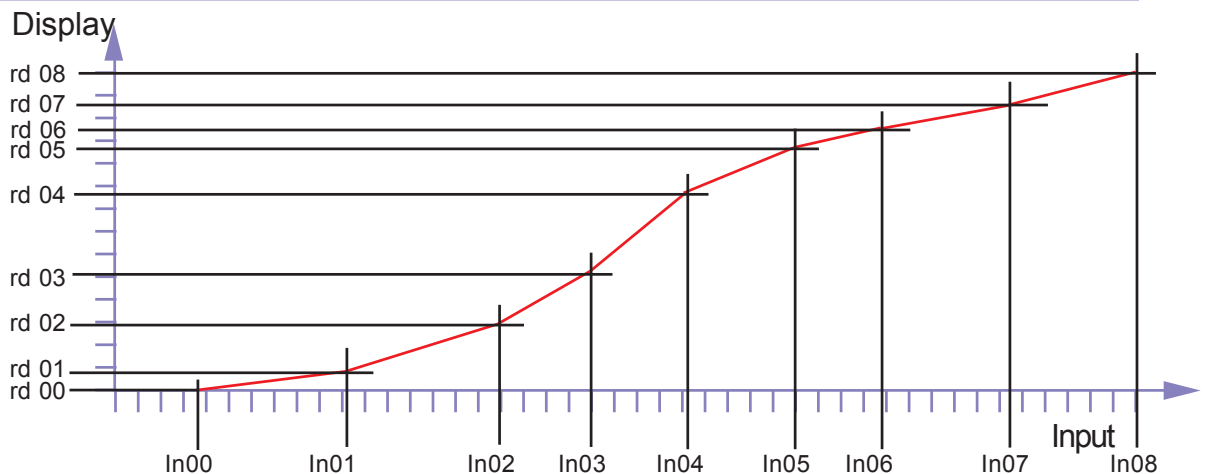




Sensor Drift Correction


If your system is normally reading 0, for example as is typical with platform scales or a torque meter, you may find a small amount of sensor drift caused by changes in temperature, ageing etc.


We can automatically correct for slow, long term drift, by comparing your signal to 0 every 30 seconds, and re-calibrating to remove any detected movement.



This does not affect the sensitivity of your system, and is only applied for readings less than 8 least-significant counts.

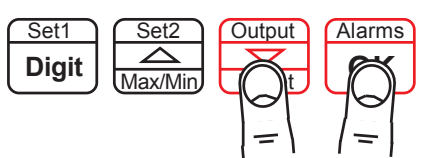The corrected value is stored in non-volatile memory, so that any drift trend will be re-applied after you have switched off the meter.

1 —  **Lockout Switch must be OFF**  
Press together, briefly

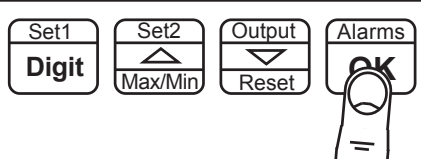2 —  Press OK button briefly and repeatedly until you see **drF.0** or **drF.1** displayed for 4 digits, or **dr Ft.0** or **dr Ft.1** for 6 digits.

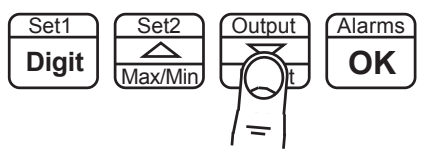3 —  Press DOWN or UP button to toggle between **drF.0** or **drF.1** (4 digits), or **dr Ft.0** or **dr Ft.1** (6 digits).
Press briefly to toggle
drF.0 or **dr Ft.0** = No Correction (Def.)
drF.1 or **dr Ft.1** = Correction is active

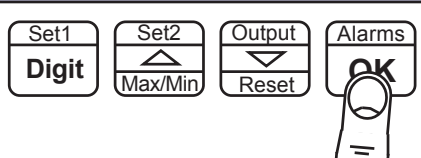4 —   **Done!**
Press to accept

Logic Input Functions

The three contact closure inputs on the rear of the meter have default functions which are:-

- Contact closure 1 = Tare
- Contact closure 2 = Peak/Valley display
- Contact closure 3 = Reset

You can re-assign these to include :HOLD, Nett/Gross value display, Memory page address 1,2 or 4 (only if Multi-memory MEM option is installed)

1


Set1
Digit


Set2
Max/Min

Output
↓
Reset


Alarms
OK

Lockout Switch must be OFF





Press 3 seconds



Circuit board ON

2

Set1
Digit

Set2
Max/Min

Output
↓
Reset

Alarms
OK

Press repeatedly until you see **CC. 1**, followed by the existing function for Contact Closure 1.

After you have set **CC. 1**, you will get the prompt **CC.2** to allow you to set Contact Closure 2 function and when you have set CC.2 you will get the prompt **CC.3** to allow you to set Contact Closure 3 function

3

Set1
Digit

Set2
Max/Min

Output
↓
Reset

Alarms
OK

Use UP or DOWN buttons to select from these available functions...

TARE	= Tare display to 0
PU	= Peak/Valley toggle
rSt	= Reset
Hold	= Freeze display
net.9r	= Net / Gross display (4 digits)
net.9r	= Net / Gross display (6 digits)
PA. 1	= Page Address 1*
PA.2	= Page Address 2*
PA.4	= Page Address 4*

Defaults are:-

CC. 1 = TARE

CC.2 = PU

CC.3 = rSt


4

Set1
Digit


Set2
Max/Min

Output
↓
Reset

Alarms
OK



Press to accept



Done!

* Only available if the Multi-memory MEM option is installed


Logic Input Connections and Front Buttons

The previous page explained how to select the functions of the 3 logic inputs. You can connect remote contact closures or open NPN collectors to activate these logic inputs.

The logic input provides a 5V DC signal. When you connect this to common, a current of 1mA will flow. Because this is a small signal, we recommend you use switches with gold plated contacts, or self cleaning contacts, for best long term reliability.

The logic inputs are not galvanically isolated from the input signal.

The logic inputs are only activated when the lockout switch is ON

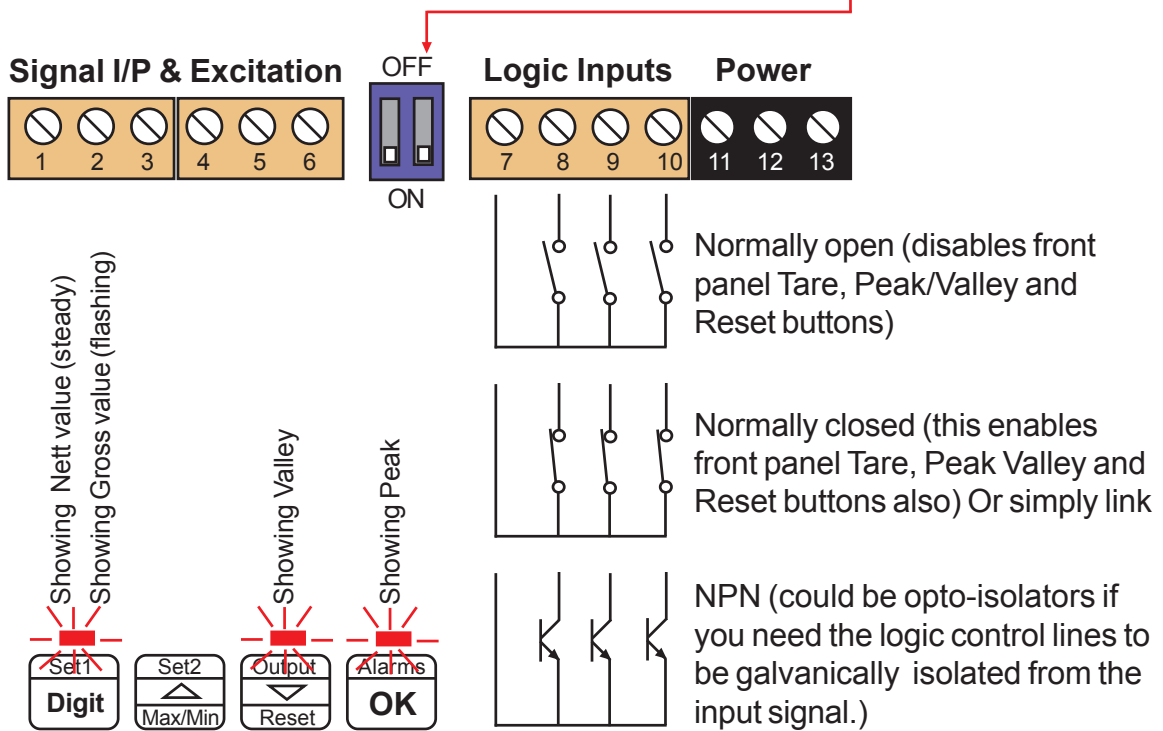

TARE = Tares display to 0. Often used in weighing systems to zero a display prior to making a measurement. Net weight is shown once tared. When a display has been tared the small LED above the Set1 button will be illuminated.

PU = Peak/Valley toggle. Allows you to view the maximum and minimum values which have been displayed since last reset. 0% LED illuminates when showing valley, 100% LED illuminates when showing peak.

rst = Reset. This clears any tare, peak, valley, alarm latch.

Hold = Freezes the displayed value for as long as the Hold input is closed.

Net.Gr = Allows toggle between Net and Gross values on the display (4 digits).


Net.Gr = Allows toggle between Net and Gross values on the display (6 digits).

PA.1 .. 4 = Page Addresses, if MEM option is installed.

Factory Defaults


You can return the display to its factory default conditions whenever you wish. If you do so, you will permanently lose all your settings and will need to start from the beginning again.

The calibration Audit Counter will NOT be reset, there is no way provided to reset this value, as it is intended as a secure record to indicate whether changes have been made to the display since it was last calibrated..

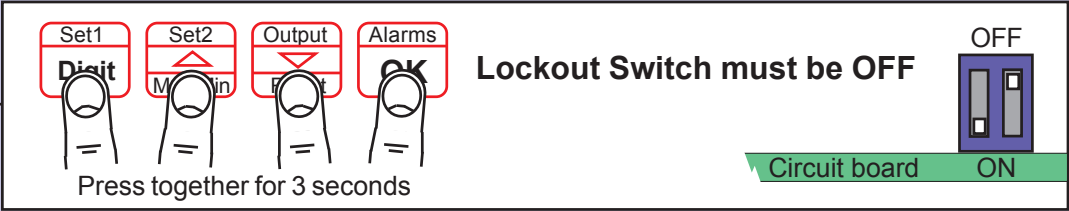
- 

1 — Press together for 3 seconds

Lockout Switch must be OFF

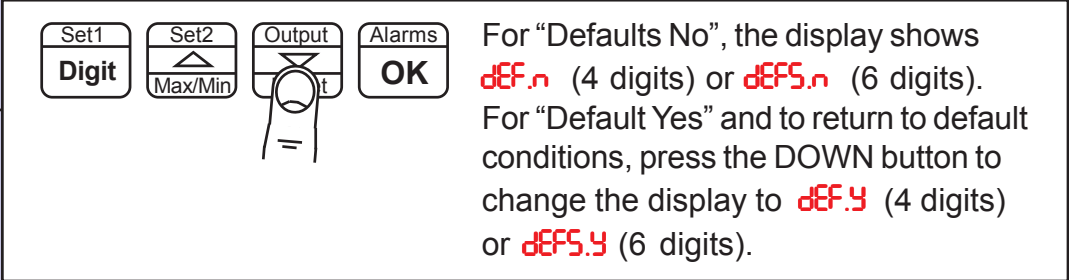Circuit board ON
- 

2 —

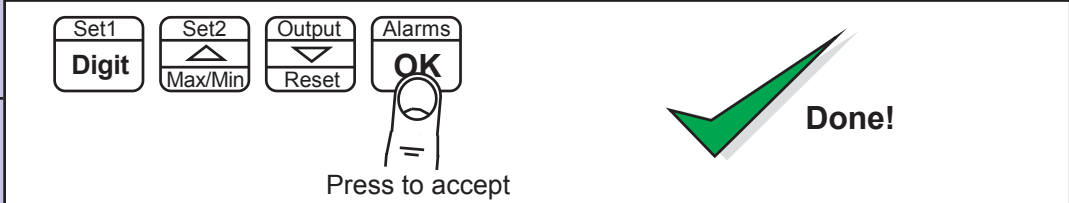For “Defaults No”, the display shows **dEF.n** (4 digits) or **dEFS.n** (6 digits).
For “Default Yes” and to return to default conditions, press the DOWN button to change the display to **dEF.Y** (4 digits) or **dEFS.Y** (6 digits).
- 

3 —


Done!

Press to accept

Calibration Audit Number

Your display includes a non-resettable counter which increments each time you make a change to the display’s calibration. This is useful if you want to check whether a display has been altered since it was last calibrated.

The calibration audit number ranges from **CL01** to **CLFF** (4 digits) or **CL01** to **CLFF** (6 digits), allowing up to 255 alterations to be recorded. Whenever you want to check the calibration audit number, press and hold the 2 outer buttons (Set1 + Alarms) for more than 3 seconds.

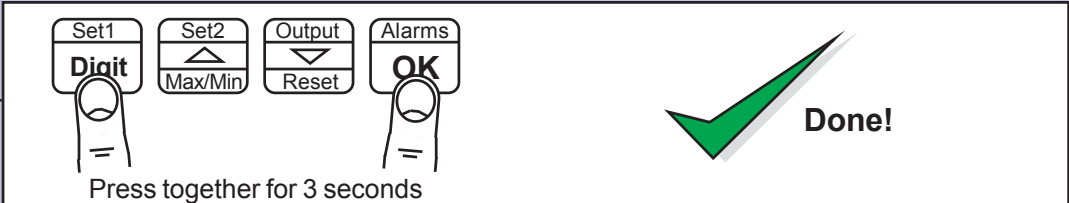- 

1 —

Done!

Press together for 3 seconds

Signal Filtering / Averaging

You can adjust the filtering time constant to reduce the effect of noise or instability on your input signal.

A larger FIL value will give a more stable display, but the response to signal changes will be slower.

Because your output options, such as analogue output, alarm relays and serial output are all derived from the displayed value, they will respond at the same rate as the filtered display.

1

Set1
Digit

Set2
M Min

Output
F t

Alarms
OK

Press 3 seconds

Lockout Switch must be OFF

OFF

ON

Circuit board

2

Set1
Digit

Set2
M Min

Output
Reset

Alarms
OK

Select, then press OK to accept

For 4 digits, display shows **HF !.X** where **X** is the amount of basic filtering.
A=Low **b**=Medium **C**=High **d**=Most
 (Default = **HF !.C**)

3

Set1
Digit

Set2
M Min

Output
Reset

Alarms
OK

Select, then press OK to accept

For 4 digits, display shows **F !.XX** where **XX** is the time constant in seconds. Use the UP or DOWN button to increase or decrease this value. (Default = **F !.00**)

4

Set1
Digit

Set2
M Min

Output
Reset

Alarms
OK

Select, then press OK to accept

For 6 digits, display shows **F !L.XX.X**, where **XX.X** is the time constant in seconds. Use the UP or DOWN button to increase or decrease this value
 (Default = **F !L.00.0**)

5

Set1
Digit

Set2
Max/Min

Output
Reset

Alarms
OK

Press to accept

✓

Done!

See also Filter Jump setting in the Advanced Menu, if your signal is particularly noisy and you cannot get sufficient smoothing with this filter.

See also page 44 for input board configuration, to bypass the 7Hz active filter if fast unfiltered response required.

Filter Jump Value


The Filter Jump value allows you to decide how the display will respond to a process step change. It does this by overriding the filtering, if the input signal moves by more than a chosen amount in one conversion. The Filter Jump default value is 10%.

This means that for noise amplitude which has a peak value of less than 10% of the input range, filtering will be applied. Any signal movement greater than 10% of the input range will cause the display to jump immediately to that value, without filtering. After that jump, normal filtering will be re-applied, provided signal movement thereafter is less than 10% per conversion.

Guidance:

For noisy systems, increase the Filter Jump value up to a maximum of 99. Choose a value which gives a good compromise between filtering and response speed.

For reasonably clean signals, a Filter Jump value of around 10 or less will give a good compromise between filtering and response speed to step change inputs.

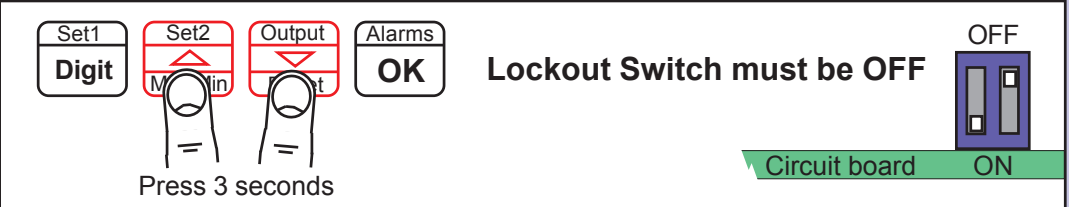
- 

1

Set1 Digit Set2 Max/Min Output Reset Alarms OK

Press 3 seconds


Lockout Switch must be OFF

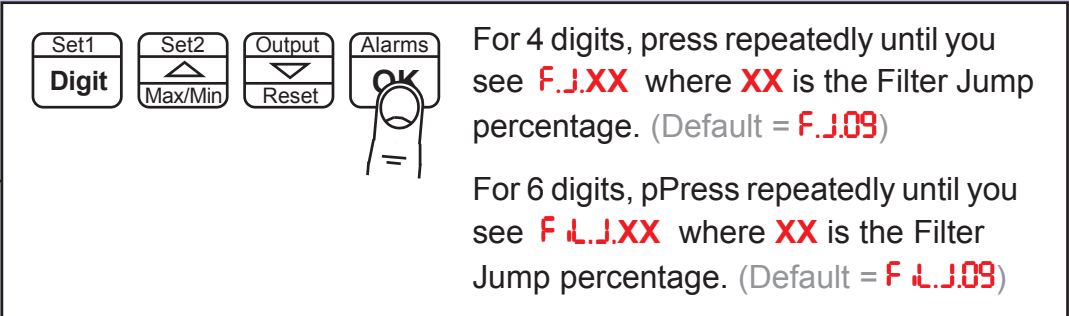Circuit board ON
- 

2


Set1 Digit Set2 Max/Min Output Reset Alarms OK

For 4 digits, press repeatedly until you see **F.J.XX** where **XX** is the Filter Jump percentage. (Default = **F.J.09**)

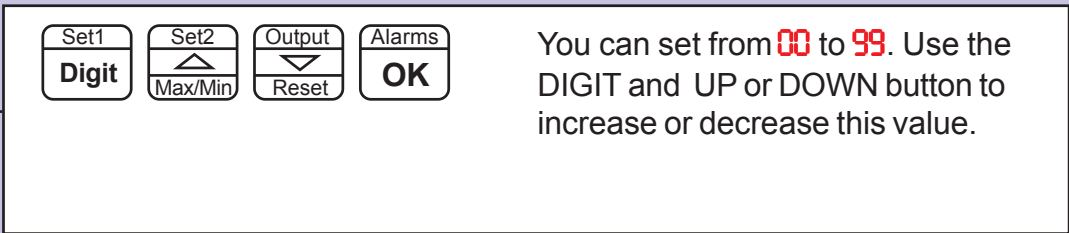For 6 digits, pPress repeatedly until you see **F.L.J.XX** where **XX** is the Filter Jump percentage. (Default = **F.L.J.09**)
- 

3

Set1 Digit Set2 Max/Min Output Reset Alarms OK

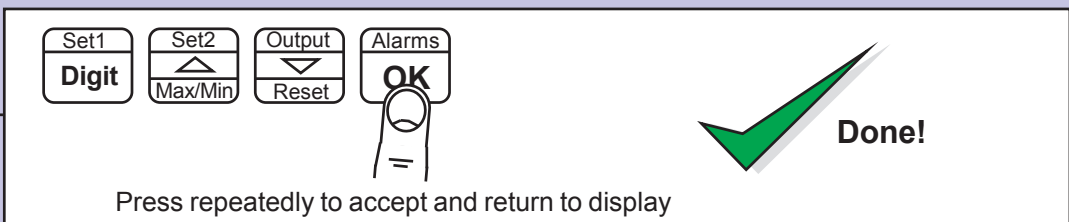You can set from **00** to **99**. Use the DIGIT and UP or DOWN button to increase or decrease this value.
- 

4

Set1 Digit Set2 Max/Min Output Reset Alarms OK




Press repeatedly to accept and return to display


Done!


Last Digit rounding Up by 1, 2, 5, 10, 20 or 50



You can adjust the way the display rounds up, which is useful if you want to display a very large number, but do not want jitter on the last digit.

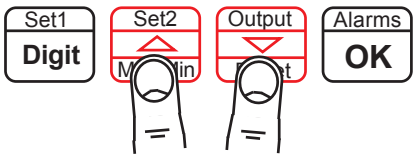The display can be set to round up to the nearest 1 (no rounding) 2, 5, 10, 20 or 50

1 —  **Lockout Switch must be OFF** 
Press 3 seconds 

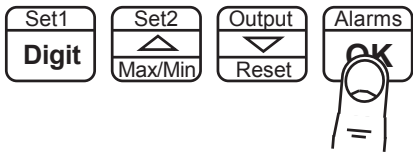2 —  For 4 digits, press repeatedly until you see **L.d.X** where X is either 1,2,5,10,20 or 50, (Default = **L.d. 1**)
For 6 digits, press repeatedly until you see **LSt.X** where X is either 1,2,5,10,20 or 50. (Default = **LSt 1**)

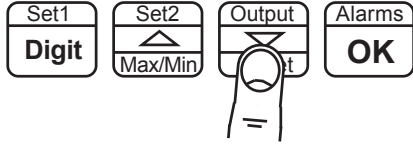3 —  Press repeatedly to change the LST value to the one you want.

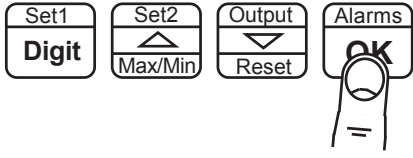4 —   **Done!**

Scale Factor Adjustment

After you have calibrated your meter, you can use the SCALE feature to make fine adjustments to calibration, without affecting the calibration itself.

Examples:

1. Changing weight units of measure from kg to pounds

You could also use the SCALE to convert your readout from kg to pounds, without affecting the calibration. Simply set SCALE = 2.205 and your meter which was calibrated in kg will now read in pounds.

2. Correcting for gravitational variance

Your weighing system was calibrated where gravitational acceleration = 9.812 m/s^2 (London). You then move the system to Bangkok where gravitational acceleration is reduced to 9.782 m/s^2

You can correct for this difference by setting Scale = $9.812 / 9.782 = 1.003$, so that a given mass in Bangkok will show the same weight as it did in London. Set Offset = 0.0000

See http://en.wikipedia.org/wiki/Earth%27s_gravity

1 — Lockout Switch must be OFF

Press 3 seconds

Circuit board ON

2 — For 4 digits, press repeatedly until you see **SCAL**, followed by the existing scale factor. (Default = **00 1.0**)
For 6 digits, press repeatedly until you see **SCALE**, followed by the existing scale factor. (Default = **00 1.000**)

3 — Use DIGIT button to select each digit in turn, UP or DOWN buttons to increase or decrease each digit's value. Press OK when done.

4 — Press to accept


Done!

You may want to adjust an offset value also, see separate OFFSET page for this feature.

Offset Adjustment


After you have calibrated your meter, you can use the Offset feature to make fine additions or subtractions to the reading, without affecting the calibration itself.


For example if your weighing structure is altered after calibration and you want to subtract the effect of 37kg of extra metalwork which was welded to the hopper, you can easily do this by entering a value of -37 in the offset value.

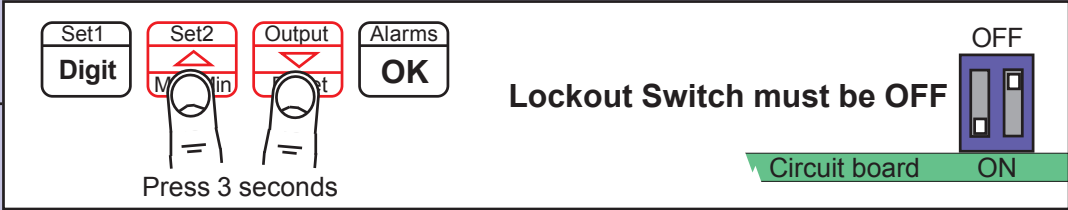
- 

1 — Lockout Switch must be OFF

Press 3 seconds

Circuit board ON
- 

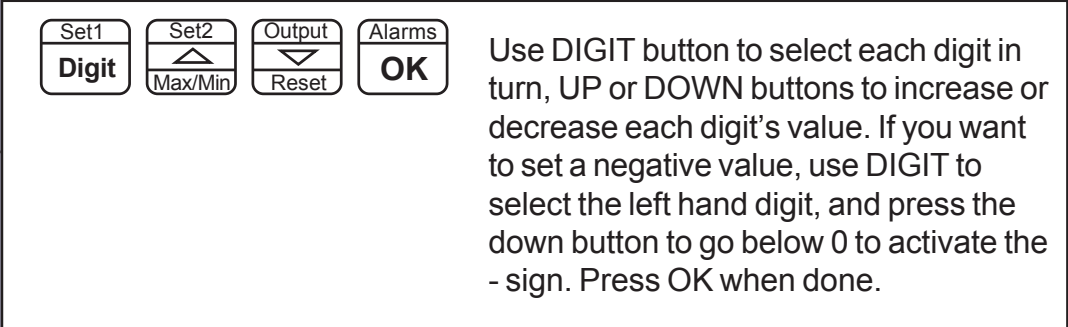2 — Press repeatedly until you see **OF.St** (4 digits) or **OFFSET** (6 digits), followed by the existing offset value. (Default is **000.0** for 4 digits or **000.000** for 6 digits)
- 

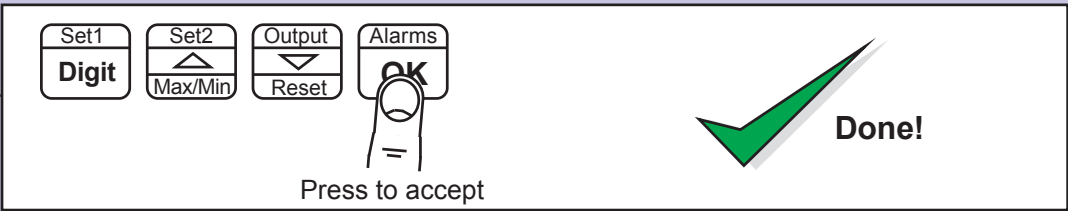3 — Use DIGIT button to select each digit in turn, UP or DOWN buttons to increase or decrease each digit's value. If you want to set a negative value, use DIGIT to select the left hand digit, and press the down button to go below 0 to activate the - sign. Press OK when done.
- 

4 — Press to accept


Done!


You may want to adjust a SCALE FACTOR value also, without affecting calibration. See the separate SCALE page for this feature.


Menu Timeout Adjustment


The display has a default timeout of 60 seconds, to allow you sufficient time to refer to the manual between key operations.

You can make this period shorter, if you wish, once you become more familiar with the setup method.

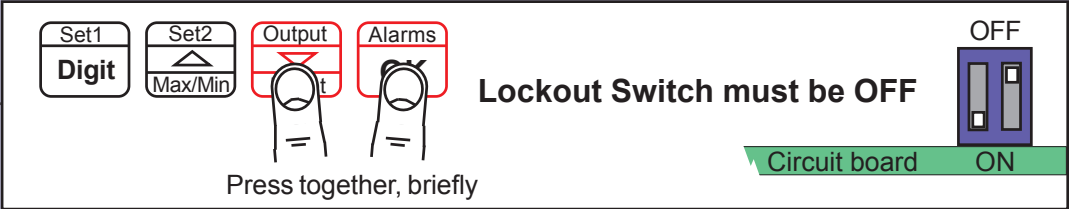1 —  Press together, briefly

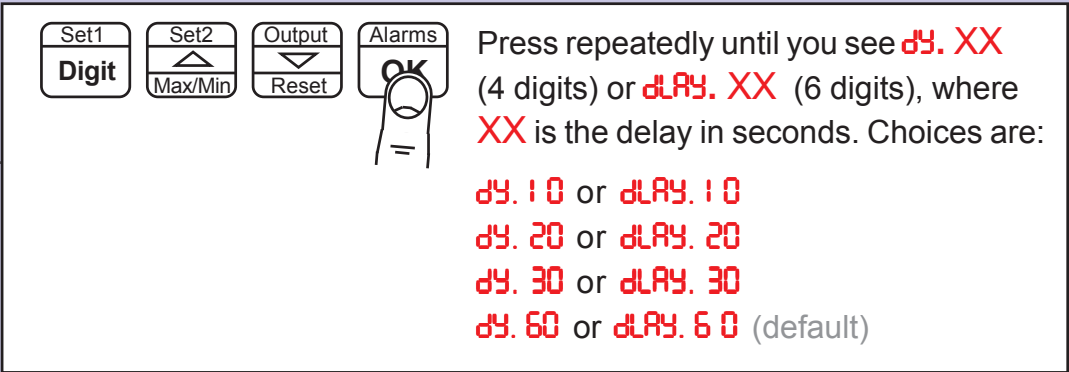2 —  Press repeatedly until you see **dY. XX** (4 digits) or **dLAY. XX** (6 digits), where **XX** is the delay in seconds. Choices are:
dY. 10 or **dLAY. 10**
dY. 20 or **dLAY. 20**
dY. 30 or **dLAY. 30**
dY. 60 or **dLAY. 60** (default)

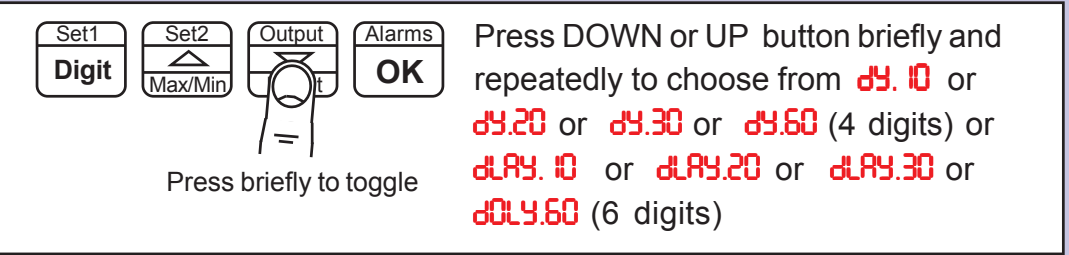3 —  Press **DOWN** or **UP** button briefly and repeatedly to choose from **dY. 10** or **dY. 20** or **dY. 30** or **dY. 60** (4 digits) or **dLAY. 10** or **dLAY. 20** or **dLAY. 30** or **dLAY. 60** (6 digits)

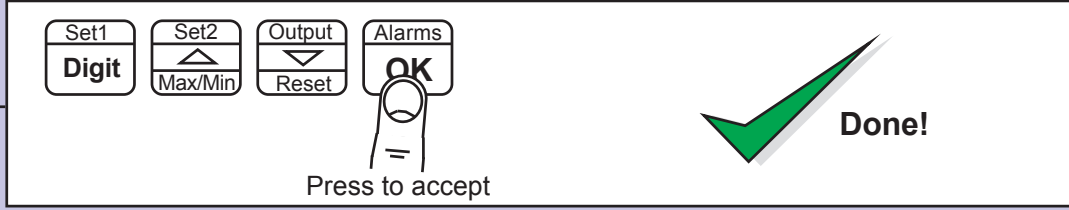4 —  Press to accept

Reverse Display Function (Mirror Image)

If you need to be able to see a reflection of the display in a mirror or other reflective surface, for example in a simple heads-up system, or for drivers reversing into a bay, using mirrors only, you can set the display to show as a mirror image.

1


Set1
Digit

Set2
Max/Min

Output
↓

Alarms
OK

Lockout Switch must be OFF



Circuit board ON

Press together, briefly

2

Set1
Digit

Set2
Max/Min

Output
Reset

Alarms
OK

Press OK button briefly and repeatedly until you see:

rEU.0 (Default) or rEU.! (4 digits)

rEU.d0 (Default) or rEU.d! (6 digits)

Press OK button briefly and repeatedly

3

Set1
Digit

Set2
Max/Min

Output
↑

Alarms
OK

Press DOWN or UP button briefly and repeatedly to choose from

rEU.0 or rEU.d0 (normal display) or

rEU.! or rEU.d! (mirror image display)

Press briefly to toggle


4

Set1
Digit

Set2
Max/Min

Output
Reset

Alarms
OK



Done!

Press to accept

rEU.d 0



Example of normal display format displaying the number 876543

rEU.d !



Example of Mirror Reverse display format displaying the number 876543

Bootup Routine and Tare Save Choices





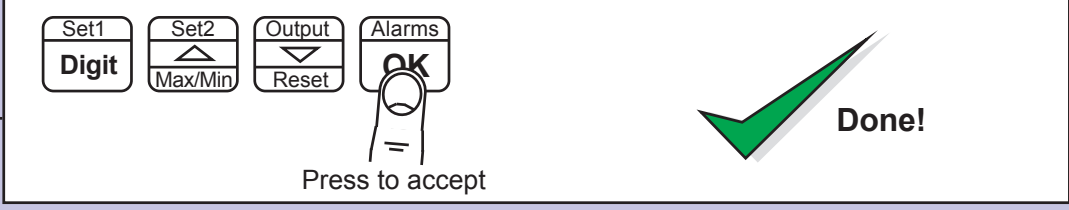
When you switch on your meter, it can be set to power up with 3 possible summary message combinations. The choices are:-

bt 0 (4 digits) or **boot 0** (6 digits) = Segment test, followed by a full summary of software revision, calibration audit number, model number, installed options.

bt 1 (4 digits) or **boot 1** (6 digits) = Segment test followed by model number (Default)

bt 2 (4 digits) or **boot 2** (6 digits) = No summary, meter displays the measurement value immediately when power is applied.

bt 3 (4 digits) or **boot 3** (6 digits) = All segments illuminate permanently, until a button is pressed.

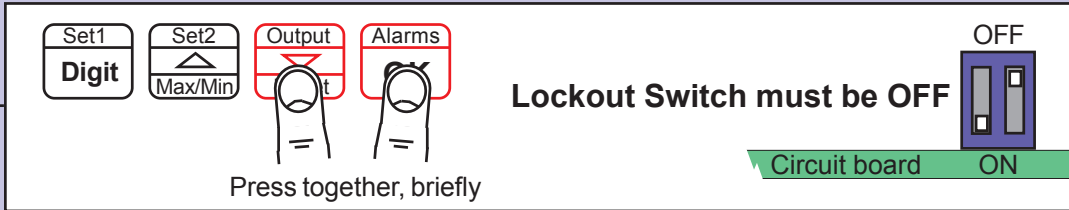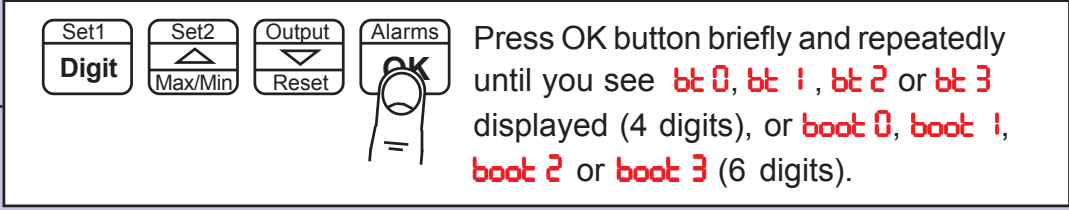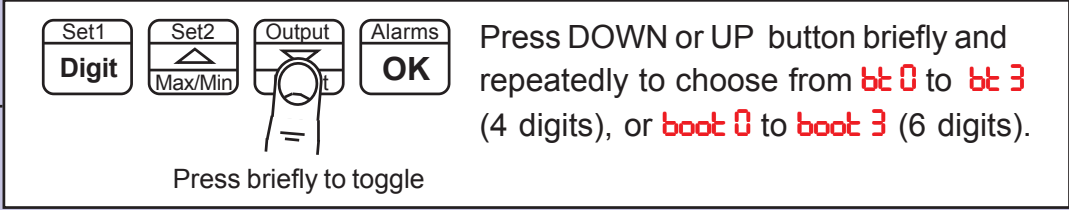- 1** — 
- 2** — 
- 3** — 
- 4** — 
- 5** — 



You can trigger the full summary message whenever you want, without having to power the meter off, by pressing and holding the 2 outer buttons (Set1 + Alarms) for more than 3 seconds.

Multi-Program Memory Option MEM

The three contact closure inputs on the rear of the meter may be used to call up between 1 to 7 additional meter setup memories (pages), if the MEM option has been installed. This allows you to save up to 8 complete sets of independent calibrations, alarm settings, analogue output settings and serial comms settings.

First decide how many memory pages you want, as this will determine how many logic inputs you will need to use for the addressing. Logic inputs not required for Page Addressing can be used for other functions such as Tare, Reset, Display Hold, Peak/Valley display.

If you have used all 3 logic inputs for Page Addressing, you can still use the meter's front panel buttons to perform Tare, Reset and peak/Valley view.

See "Contact Closure Input Functions" page for CC.1, CC.2, CC.3 and COP settings


Total number of pages	Logic Inputs required for addressing
1	none, standard single page meter
2	1 Set CC.1 = PA.1
3 or 4	2 Set CC.1 = PA.1, Set CC.2 = PA.2
5 to 8	3 Set CC.1 = PA.1, Set CC.2 = PA.2, Set CC.3 = PA.4

1. Set lockout switches OFF, and set page address to 0 or unplug the logic connector.
2. Set the copy instruction to **COP. 1** in page address 0 (found after you set CC3) .
3. Press all 4 buttons together, display shows **dEF.n** (4 digits) or **dEFS.n** (6 digits).
4. Press the Up arrow to change display to **dEF.y** (4 digits) or **dEFS.y** (6 digits), and press OK.
5. If you want all channels to share a common setting, eg calibration, do that setting now.
6. When you want to do separate settings for each channel, set COP.0

Programming and recalling individual pages

Plug the logic input connector back in, if you removed it earlier. Select a page address using the switch combinations shown below, wired to the Logic Input connector ...

Page address 0	All logic inputs open
Page address 1	CC.1 closed to Common
Page address 2	CC.2 closed to Common
Page address 3	CC.1 and CC.2 closed to Common
Page address 4	CC.4 closed to Common
Page address 5	CC.1 and CC.3 closed to Common
Page address 6	CC.2 and CC.3 closed to Common
Page address 7	All logic inputs closed to Common

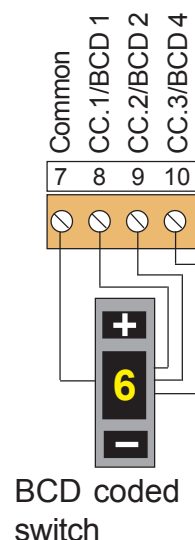

Perform the settings you require, according to the pages in this manual. Do this for all page addresses required. Then put the lockout switch in its ON position. Now, if you select a page address, the meter will briefly confirm the chosen page address on screen, and will then function according to the settings you programmed for that address.

Suitable BCD coded switches are available from many electrical supply stores. For example consider Kraus & Naimer part A540-600 E24 or Apem part number IRBC10N1248 or London Electronics part number SW2P-8W-BCD, which also provides separate 2 pole 8 way signal selection function.

Error Codes and Fault Finding



1. Under Range. The meter is being asked to display a value which is more negative than its limit of -1999



2. Over Range. The meter is being asked to display a value which is higher than its limit of 9999

If no loadcell is connected to the display, you will see one of these fault codes.

In addition, these fault codes could be displayed because the signal is too negative, too positive, or because there is a wiring error, or because the display's scaling has been adjusted to give excessive sensitivity, or because there is a fault in the display.

a. Measure the input signal on terminals 3(-) and 4(+) and confirm that it is between -40mV DC and +40mV DC. You can temporarily force the display's input signal to 0mV by wiring a link between terminal 3 and terminal 4, but keep the loadcell connected in addition to this link, as the display needs to see a full bridge at its input

b. Measure the excitation voltage on terminals 1(-) and 6(+) and confirm that it is between 9.5 and 10.5V DC. If it is less than 9.5V, remove the plug-in connector and measure the voltage directly on pins 1 and 6 with the connector removed. If it is still less than 9.5V, and if the meter has not been purposefully modified to give lower excitation, then there is most likely a fault with the display and it should be returned to us for the attention of our QA Manager, with a report of what you found, for repair.

c. Measure the sense voltage on terminals 2(-) and 5(+) and confirm that it is between 4 and 10.5V DC. If it is not, please confirm that you have connected terminal 1 to terminal 2 and terminal 5 to terminal 6, either at the meter end of the loadcell cable or at the loadcell end.

d. Measure the voltage between terminal 2(-) and terminal 3(+) It should be half of the voltage you measured in step 3. If it is not, there is most likely a wiring error between the display and the loadcell, or the loadcell is faulty. Check the wiring according to the installation instructions for the loadcell and the display. If that appears to be correct, measure the resistance of the four loadcell branches according to the loadcell manufacturer's specifications.

e. If steps 1 to 4 were satisfactory, the problem may be caused by the scaling being too sensitive. If you are happy to do so, it is a simple matter to reset the display's scaling to the factory default conditions. Put the lockout switch off and press all 4 buttons together for around 3 seconds until the display shows "dEFS n" press the UP button once so the display shows "dEFS Y". Now press the OK button and the display will be reset to factory defaults.

If still no success, please return the display to us for the attention of our QA Manager, with a report of what you found, for repair.

How to Install Option Boards



Where the product is intended for “UL” installations removal or addition of option boards is not permitted.




Warning: Disconnect power before you expose the internals of the display

If you want to open your display to install or modify option boards, follow these steps...

- 1) Switch off power to the display and unplug all connectors.
- 2) Undo all the thumb screws on the rear case, store them safely and remove the back panel
- 3) Locate the main option board, which will be similar in appearance to the diagram below. If a main option board is absent, which will be the case if the display was ordered without any output options, then a main option board will need to be fitted.

The board assemblies will look like this...

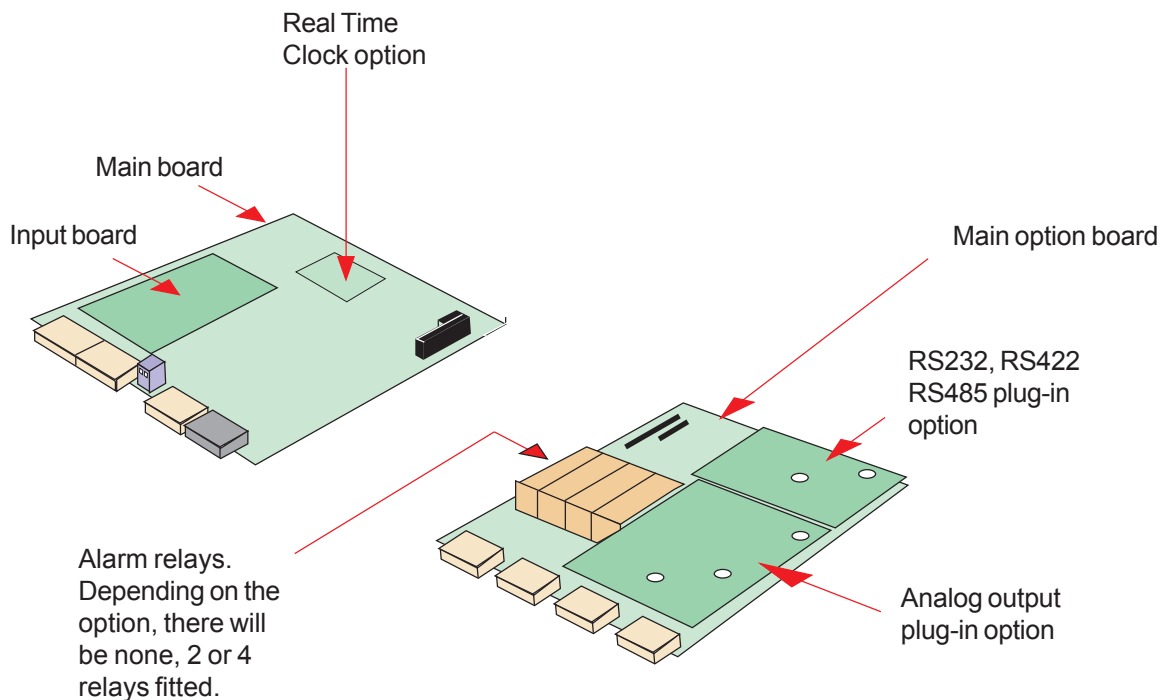

The analog output and RS232 or RS422 plug-in option boards are fixed to the main option board with white plastic pillars. You must apply a firm force when fitting or removing these options.

Always be careful to connect the pins to sockets accurately. When reassembling, make sure option boards are firmly fixed to the upper option board.

Waste Electrical Electronic Equipment (WEEE)

In Europe, this equipment must be disposed of in accordance with European Parliamentary Directive 2002/96/EC

This directive encourages recycling and the reduction of waste materials in the environment.

This means it must be sent to an approved recycling plant if you want to dispose of it.

It must not be thrown away with general rubbish.



WEEE Waste Recycling

If you are unable to dispose of this item locally, you may send it to us for recycling.

Conditions:

1. We will only accept items of our manufacture.
2. You must pay for the transport of the goods to us.
3. We will only accept items if they include a signed declaration by an authorised person in your organisation, stating that :-
 - i. The item is safe to handle and has no contaminants which may be harmful to health.
 - ii. You wish us to dispose of or destroy the item(s)

Equipment Specifications

Case Material	Heavy duty welded uPVC
Connectors	Internal detachable Screw Terminal connectors accessed via compression glands
Environmental	Storage Temperature range -20 to +70°C, non-condensing Operating temperature range 0 to 50°C. Allow 30 minutes for this display to reach thermal equilibrium. Internal heater option available for use in conditions down to -25°C.
Power Burden	100-240 VAC, 48V AC, 45 to 60Hz or 11-30 VDC optional 40VA maximum
Sealing	IP65 all round, provided the display is mounted vertically and that all cable glands and rear case-closure screws are properly secured.
Input Signals (bipolar)	4 or 6-wire loadcell up to +/-40mV (+/- 100mV option) Active filter offers 7Hz rolloff - see separate page for input board filterconfiguration.
Input Resistance	>10 Megohms
Accuracy	+/-0.05% of range
Span tempco	25 ppm/°C
Zero Tempco	30 ppm/°Cs
5V Excitation voltage	5 VDC nominal rated at 40 mA. Must connect to Sense.
10V Excitation voltage	10 VDC nominal rated at 120 mA. Must connect to Sense.
Excitation Sense	Ratiometric, 4V absolute minimum allowed after line drops
Filtering / smoothing	Selectable time constants of 0 to 25 seconds.
A/D conversion	Sigma-Delta 10 conversions per second, 50/60Hz rejection. Resolution 1 in 400 000 max. over full range
Display update rate	10 readings per second.
Display Range (max)	-1999 to +9999, depending on available signal level.

Plug-In Output Options


Analog, Alarm, Serial, Clock See separate manuals available from our website.

Record of Revisions

17 November 2010	Version F00.19 Software released. Intended for use with 9122-2470 input board, having switched capacitor input filter feature. The newly released 9122-2470 input board allows selection of 5V or 10V excitation.
5 January 2011	Version F00.20 Software released. Allows serial data output to derived from Net or Gross measurement.
14 February 2011	Version F00.21 software released. Additional bootup routine added.
28 February 2011	Warranty increased to 3 years and terms added.
22 August 2011	Corrected Remote programmer connector details.
30 July 2014	Version F00.23 software released with V4 input board.
21 January 2016	Mounting dimensions amended for flush case bosses

Loadcell Connection Notes


Signal I/P & Excitation

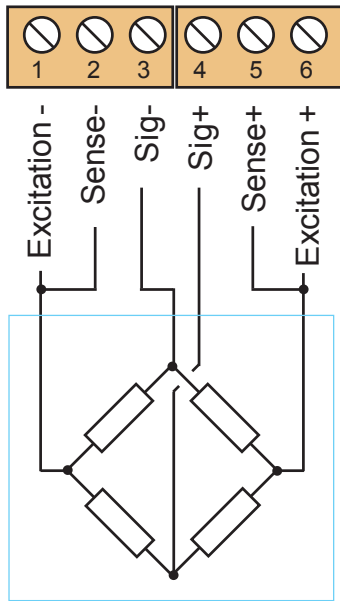

4-wire connection for short cable runs

Important - Sense + and Sense - must always be referred to the excitation voltage. Never leave these terminals open.

Signal I/P & Excitation

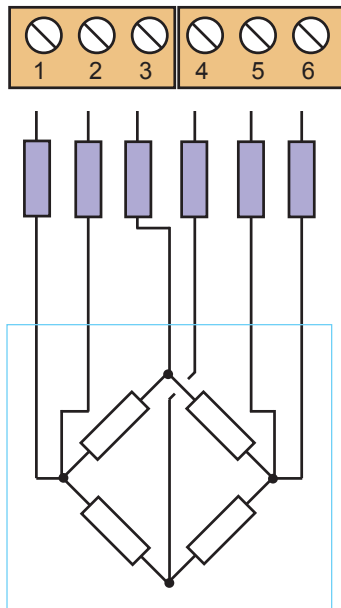

6-wire connection for long or high resistance cable runs

Cable and/or zener barrier resistance


Cable and/or zener barrier resistance must not cause the excitation voltage to drop below 4V.

NB If using galvanic isolation barriers, connect 10K from terminal 2 to terminal 3 and 10K from terminal 3 to terminal 5 to maintain the input signal within the common mode range of the excitation sense circuit.



Millivolt input only?

Link Exc+ to Sense+ and link Exc- to Sense-
Set Sig- to 5V using 2 x 10K resistors.


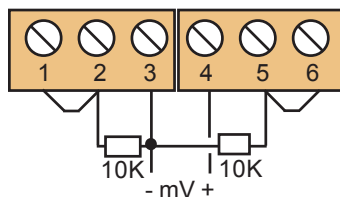


Input Board Filter Configuration

The new input board now offers a sharp cutoff active filter which rejects all vibrations above 7 Hz. This is ideal in applications where mixing or vibration is common.

For optimum rejection of noise, we recommend you set the Fil.J parameter to 99 and choose a value for FIL which offers adequate filtering. Too large a value for FIL will slow the response of the meter.

If you need fast response, Disable the 7Hz filter according to the jumper settings shown below.

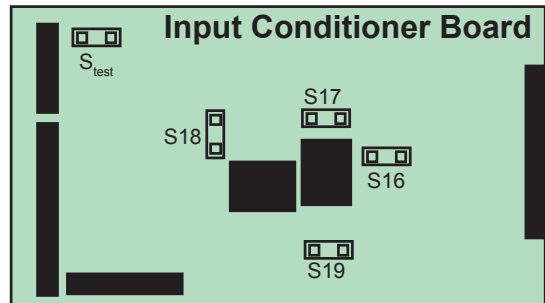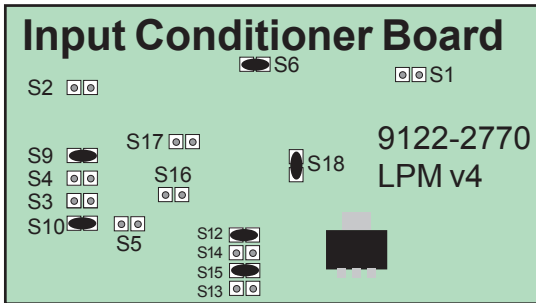

Excitation voltages

5V DC Link S12 and S13. Open S14 and S15
 10V DC Link S12 and S15. Open S14 and S13
 (default)

Default Input configuration switches

Link S6, S9, S10, S12, S15, S18, S19
 Open S1, S2, S3, S4, S5, S13,
 S14, S16, S17, S_{test}

Excitation Ratiometry

Ratiometric. Link S6. Open S1 (default)
 Non ratiometric. Link S1. Open S6

Active 7Hz. Low pass filter

* Enable: Link S18, S19. Open S16, S17, S_{test}
 Disable: Link S16, S17. Open S18, S19, S_{test}

Declaration of CE Conformity

Declaration Reference : INTUITIVE Mk2
Issue Date : 30 April 2007
Products Covered : INTUITIVE Mk2 series
Title : DOC-INTUITIVE2

This is to confirm that the Product covered by this declaration has been designed and manufactured to meet the limits of the following EMC Standard :

EN61326-1:1997

and has been designed to meet the applicable sections of the following safety standards

EN61010-1:2001



Conditions

The meters are permitted a worst case error of 1% of A/D range during electro-magnetic disturbance, and must recover automatically when disturbance ceases without the need for human intervention, such as resetting, power-down etc.

The meters covered by this certificate must be installed in adherence to the following conditions:

Signal cabling shall be routed separately to power carrying cabling (includes relay output wiring)

All signal cabling shall be screened. The screen shall only be terminated to the power earth terminal at the meter end of the cable.

Declared as true and correct, for and on behalf of Laurel Electronics, Inc.

Revision:24 dated 15 March 2017

Software version FU4.01