

FLUKE®

i1000s

AC Current Probe for Oscilloscopes

Calibration Manual

LIMITED WARRANTY AND LIMITATION OF LIABILITY

Each Fluke product is warranted to be free from defects in material and workmanship under normal use and service. The warranty period is one year and begins on the date of shipment. Parts, product repairs, and services are warranted for 90 days. This warranty extends only to the original buyer or end-user customer of a Fluke authorized reseller, and does not apply to fuses, disposable batteries, or to any product which, in Fluke's opinion, has been misused, altered, neglected, contaminated, or damaged by accident or abnormal conditions of operation or handling. Fluke warrants that software will operate substantially in accordance with its functional specifications for 90 days and that it has been properly recorded on non-defective media. Fluke does not warrant that software will be error free or operate without interruption.

Fluke authorized resellers shall extend this warranty on new and unused products to end-user customers only but have no authority to extend a greater or different warranty on behalf of Fluke. Warranty support is available only if product is purchased through a Fluke authorized sales outlet or Buyer has paid the applicable international price. Fluke reserves the right to invoice Buyer for importation costs of repair/replacement parts when product purchased in one country is submitted for repair in another country.

Fluke's warranty obligation is limited, at Fluke's option, to refund of the purchase price, free of charge repair, or replacement of a defective product which is returned to a Fluke authorized service center within the warranty period.

To obtain warranty service, contact your nearest Fluke authorized service center to obtain return authorization information, then send the product to that service center, with a description of the difficulty, postage and insurance prepaid (FOB Destination). Fluke assumes no risk for damage in transit. Following warranty repair, the product will be returned to Buyer, transportation prepaid (FOB Destination). If Fluke determines that failure was caused by neglect, misuse, contamination, alteration, accident, or abnormal condition of operation or handling, including overvoltage failures caused by use outside the product's specified rating, or normal wear and tear of mechanical components, Fluke will provide an estimate of repair costs and obtain authorization before commencing the work. Following repair, the product will be returned to the Buyer transportation prepaid and the Buyer will be billed for the repair and return transportation charges (FOB Shipping Point).

THIS WARRANTY IS BUYER'S SOLE AND EXCLUSIVE REMEDY AND IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. FLUKE SHALL NOT BE LIABLE FOR ANY SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES OR LOSSES, INCLUDING LOSS OF DATA, ARISING FROM ANY CAUSE OR THEORY.

Since some countries or states do not allow limitation of the term of an implied warranty, or exclusion or limitation of incidental or consequential damages, the limitations and exclusions of this warranty may not apply to every buyer. If any provision of this Warranty is held invalid or unenforceable by a court or other decision-maker of competent jurisdiction, such holding will not affect the validity or enforceability of any other provision.

Fluke Corporation
P.O. Box 9090
Everett, WA 98206-9090
U.S.A.

Fluke Europe B.V.
P.O. Box 1186
5602 BD Eindhoven
The Netherlands

Table of Contents

Title	Page
Introduction.....	1
Contacting Fluke.....	2
Precautions and Safety Information.....	2
Instrument Compatibility	4
Electrical Specifications	5
Mechanical Specifications	7
Typical Response Curves.....	8
Performance Tests.....	9
Required Equipment.....	10
Phase Shift Test	10
mV Output Test	11
Calibration Adjustment.....	12
Calibration Adjustment Procedure	12

List of Tables

Table	Title	Page
1.	International Electrical Symbols	3
2.	Input Ranges and Accuracy.....	6
3.	Maximum Phase Shift	6
4.	Required Equipment.....	10
5.	Verification Table	10

List of Figures

Figure	Title	Page
1.	Fluke i1000s AC Current Probe	4
2.	Typical Response Curves	8
3.	Phase Test Setup	11
4.	i1000s Disassembly and Calibration Adjustment	12
5.	Calibration and Verification Setup.....	13

i1000s

AC Current Probe for Oscilloscopes

Introduction

⚠ Warning

To avoid shock or injury, do not perform the verification tests or calibration procedures described in this manual unless you are qualified to do so.

The information provided in this document is for the use of qualified personnel only.

Caution

The i1000s AC Current Probe contains parts that can be damaged by static discharge.

Follow the standard practices for handling static sensitive devices.

The information in this manual deals with the Fluke i1000s AC Current Probe for oscilloscopes, (hereafter referred to as “the Current Probe”). Information provided includes:

- Precautions and safety information
- Specifications
- Basic maintenance
- Performance test procedures
- Calibration adjustment procedures

For complete operating instructions, refer to the *i1000s Users Manual*.

Contacting Fluke

To contact Fluke, call one of the following telephone numbers:

- Technical Support USA: 1-800-44-FLUKE (1-800-443-5853)
- Calibration/Repair USA: 1-888-99-FLUKE (1-888-993-5853)
- Canada: 1-800-36-FLUKE (1-800-363-5853)
- Europe: +31 402-675-200
- Japan: +81-3-6714-3114
- Singapore: +65-6799-5566
- China: +86-400-921-0835
- Anywhere in the world: +1-425-446-5500

Or, visit Fluke's website at www.fluke.com.

To register your product, visit <http://register.fluke.com>.

To view, print, or download the latest manual supplement, visit <http://us.fluke.com/usen/support/manuals>.

Precautions and Safety Information

⚠ Warning

If the Current Probe is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

Read the “Safety Information” page before servicing or using this product.

A **Warning** identifies conditions and procedures that are dangerous to the user. A **Caution** identifies conditions and procedures that can cause damage to the Product or the equipment under test. International electrical symbols used are explained in Table 1.










⚠ Warning

To prevent possible electrical shock, fire, or personal injury:

- **To avoid injury and ensure safe operation of the probe, follow all safety precautions detailed in this manual.**
- **Never use the probe on circuits rated higher than 600 V in measurement category III (CAT III). Use extreme caution when clamping around uninsulated conductors or bus bars.**
- **CAT III equipment is designed to protect against transients in equipment in fixed equipment installations, such as distribution panels, feeders and short branch circuits, and lighting systems in large buildings.**
- **Do not hold the clamp anywhere beyond the tactile barrier.**
- **Adhere to local and national safety codes. Individual protective equipment must be used to prevent shock and arc blast injury where hazardous live conductors are exposed.**

- **Use caution when working with voltages above 60 V dc, 30 V ac rms or 42 V ac peak. Such voltages pose a shock hazard.**
- **Check the magnetic mating surfaces of the probe jaws; these should be free of dirt, dust, rust, or other foreign matter.**
- **Do not use a probe which is cracked, damaged, or has a defective cable. Such probes should be made inoperative by taping the clamp shut to prevent operation.**
- **Do not alter the Product and use only as specified, or the protection supplied by the Product can be compromised.**

Table 1. International Electrical Symbols

	WARNING. HAZARDOUS VOLTAGE. Risk of electric shock.
	WARNING - RISK OF DANGER. Consult user documentation.
	Application around and removal from uninsulated hazardous live conductors is permitted.
	Double Insulated
	Conforms to European Union directives.
	Certified by Underwriters Laboratories to North American safety standards.
CAT III	Measurement Category III is applicable to test and measuring circuits connected to the distribution part of the building's low-voltage MAINS installation.
	Earth
	AC (Alternating Current)
	This product complies with the WEEE Directive marking requirements. The affixed label indicates that you must not discard this electrical/electronic product in domestic household waste. Product Category: With reference to the equipment types in the WEEE Directive Annex I, this product is classed as category 9 "Monitoring and Control Instrumentation" product. Do not dispose of this product as unsorted municipal waste.

The i1000s has been tested according to IEC Publication 61010-2-032-94. Follow all warnings to ensure safe operation.

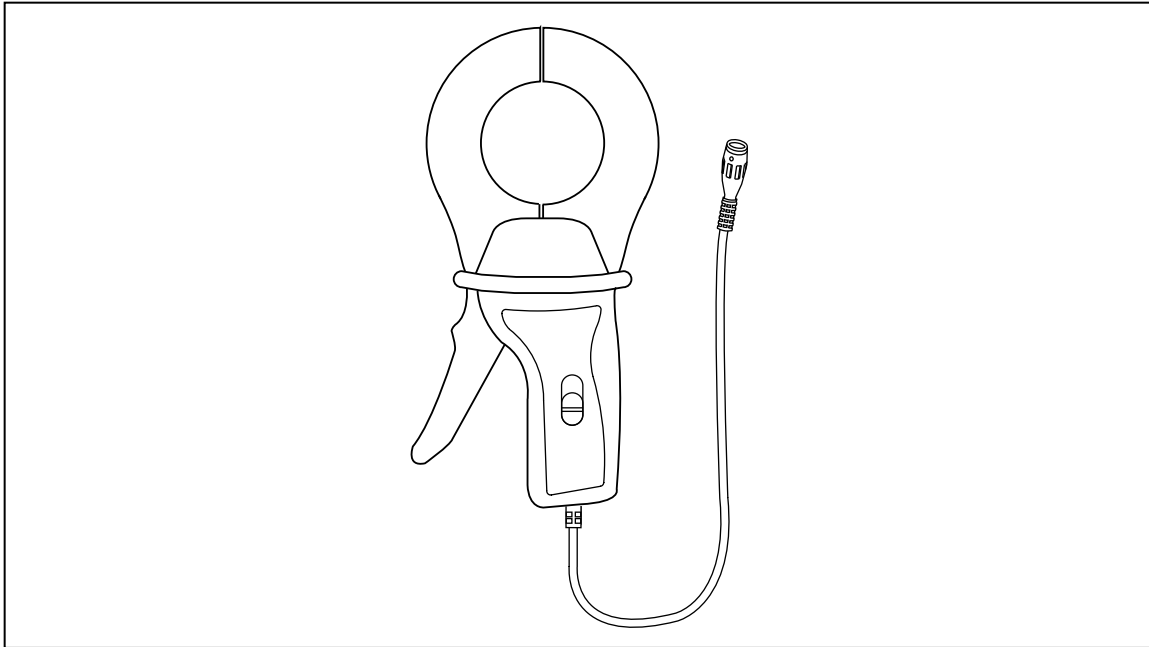


Figure 1. Fluke i1000s AC Current Probe

akp01f.eps

Instrument Compatibility

The i1000s is compatible with any oscilloscope that accepts a standard BNC connector and has an input impedance of greater than or equal to $1\text{ M}\Omega$ in parallel with a maximum of 47 pF . To achieve the stated accuracy, use the AC Current Probe with an oscilloscope having an accuracy of $\pm 2\%$ or better. The i1000s may be used with digital multimeters (DMMs) if a BNC to banana jack adapter is used.

Electrical Specifications

Current Range: 100 mA to 1000 A ac rms (2000 A instantaneous peak).

⚠ Warning

To avoid potential thermal burns from the jaws when measuring currents equal to or greater than 800 A ac rms in the ambient temperature range of 30 °C to 50 °C (86 °F to 122 °F), limit the measurement cycle to a measurement time of 5 minutes or less, followed by a cooling time of 15 minutes or more.

Output Signal: mV output signal (2 V peak max). 3 ranges, switch selectable on handle
Influence of Temperature: <0.1 % per °C for temperatures from -10 °C to +18 °C and from 28 °C to 50 °C
Usable Frequency Range: 5 Hz to 100 kHz
Load Impedance Required instrument input impedance: > 1 MΩ in parallel with up to 47 pF
di/dt max: 10 A/μs
Ampere Second Product: ¹ 1.0
Rise or fall time: <40 μs
1. To avoid the inaccurate readings that result from core saturation, the Ampere Second Product should not be exceeded. If the average amplitude times the duration of a given current pulse does not exceed 1.0 Ampere Second Product, the probe will be linear and specified accuracies will apply.

Safety

General IEC 61010-1: Pollution Degree 2

Measurement..... IEC 61010-2-032 CAT III 600 V

Electromagnetic Compatibility (EMC)

International IEC 61326-1: Portable Electromagnetic Environment

CISPR 11: Group 1, Class A

Group 1: Equipment has intentionally generated and/or uses conductively-coupled radio frequency energy that is necessary for the internal function of the equipment itself.

Class A: Equipment is suitable for use in all establishments other than domestic and those directly connected to a low-voltage power supply network that supplies buildings used for domestic purposes. There may be potential difficulties in ensuring electromagnetic compatibility in other environments due to conducted and radiated disturbances.

Caution: This equipment is not intended for use in residential environments and may not provide adequate protection to radio reception in such environments.

Emissions that exceed the levels required by CISPR 11 can occur when the equipment is connected to a test object.

Korea (KCC) Class A Equipment (Industrial Broadcasting & Communication Equipment)

Class A: Equipment meets requirements for industrial electromagnetic wave equipment and the seller or user should take notice of it. This equipment is intended for use in business environments and not to be used in homes.

USA (FCC)..... 47 CFR 15 subpart B. This product is considered an exempt device per clause 15.103.

Table 2. Input Ranges and Accuracy

Switch Position	Input Range	Accuracy*
10 A (100 mV/A)	100 mA to 10 A (20 A instantaneous peak)	3 % of reading \pm 10 mV
100 A (10 mV/A)	100 mA to 100 A (200 A instantaneous peak)	2 % of reading \pm 5 mV
1000 A (1 mV/A)	1 A to 1000 A (2000 A instantaneous peak)	1% of reading \pm 1 mV

*Accuracies and Phase Shifts are given for 48 Hz to 65 Hz; an ambient temperature of 23 °C \pm 5 °C, relative humidity of 20 % to 75 %, conductor centered in jaw window, no DC component, no external current carrying conductor, magnetic field <40 A/m and 1 M Ω /47 pF oscilloscope or meter input impedance.

Table 3. Maximum Phase Shift

100 mV/A		10 mV/A		1 mV/A	
0.1 A to 0.5 A	NA	0.1 A to 5 A	N/A	1 A to 50 A	N/A
0.5 A to 2 A	NA	5 A to 20 A	15 °C	50 A to 200 A	3 °C
2 A to 10 A	15 °C	20 A to 100 A	10 °C	200 A to 1000 A	2 °C

Accuracies and phase shifts are given for 48 Hz to 65 Hz, an ambient temperature of 23 °C \pm 5 °C, relative humidity of 20 % to 75 %, conductor centered in jaw, no DC component, no external current carrying conductor, magnetic field <40 A/m and 1 M Ω /47 pF oscilloscope or meter input impedance.

Working Voltage (clamp jaws to ground):

600 V ac rms on Overvoltage Category III circuits per IEC 61010-1-95, IEC 61010-2-032-94, and IEC 61010-2-031.

Float Voltage (output cable and connector to ground):

600 V ac rms on Overvoltage Category III circuits per IEC 61010-1-95 and IEC 1010-2-032-94.

Influence of Adjacent Conductor:

<1.0 mA/A ac

Influence of Conductor Position in Jaw Opening:

<0.5 % of reading from 10 Hz to 5 kHz

<4.0 % of reading from 5 kHz to 40 kHz

<10.0 % of reading from 40 kHz to 100 kHz.

Operating Temperature:

-10 °C to +50 °C (14 °F to 122 °F); 100 mA to 800 A ac rms continuous, 800 A to 1000 A ac rms for 5 minutes On, 15 minutes Off.

-10 °C to +30 °C (14 °F to 86 °F); 100 mA to 1000 A ac rms continuous

Storage Temperature:

-40 °C to +71 °C (-40 °F to +160 °F)

Relative Humidity:

0 % to 85 % (10 °C to 30 °C); 0 % to 75 % (30 °C to 40 °C); 0 % to 45 % (40 °C to 50 °C)

Mechanical Specifications

Maximum Cable Diameter:

2.13 inches (54 mm)

Dimensions:

4.37 inches x 8.50 inches x 1.77 inches (111 mm x 216 mm x 45 mm)

Weight:

1.21 lbs (550 g)

Output Cable:

63 inches (1.6 m) PVC-insulated lead with insulated BNC connector.

Enclosure Protection:

IP 40 (IEC 529)

Drop Test:

1 meter per IEC 68-2-32

Mechanical Shock:

100 G per IEC 68-2-27.

Vibration:

5/55/5 Hz, no less than 0.25 mm per IEC 68-2-6.

Typical Response Curves

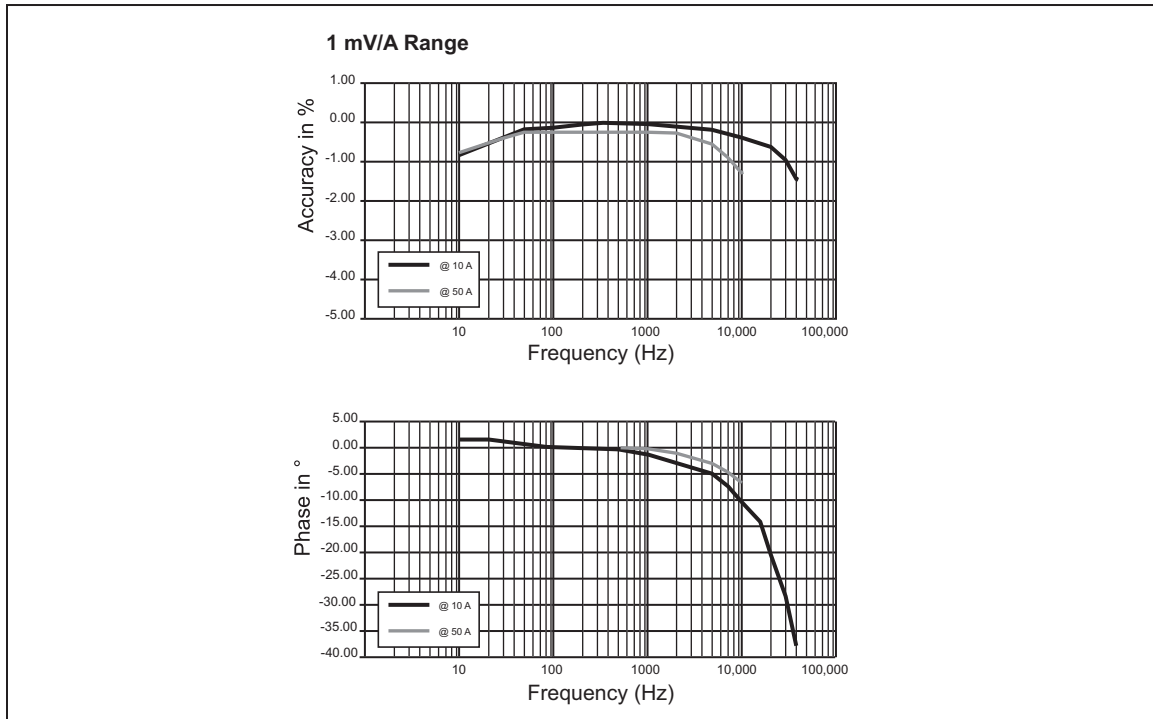


Figure 2. Typical Response Curves

akp07f.eps

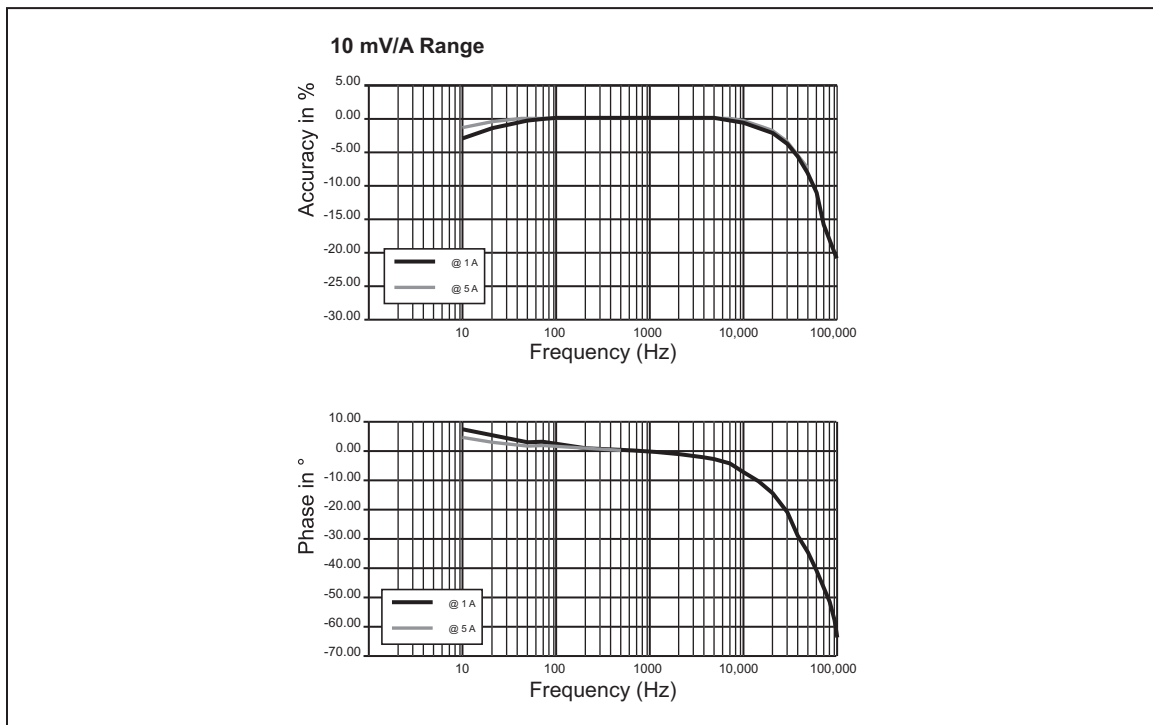


Figure 2. Typical Response Curves (cont)

akp08f.eps

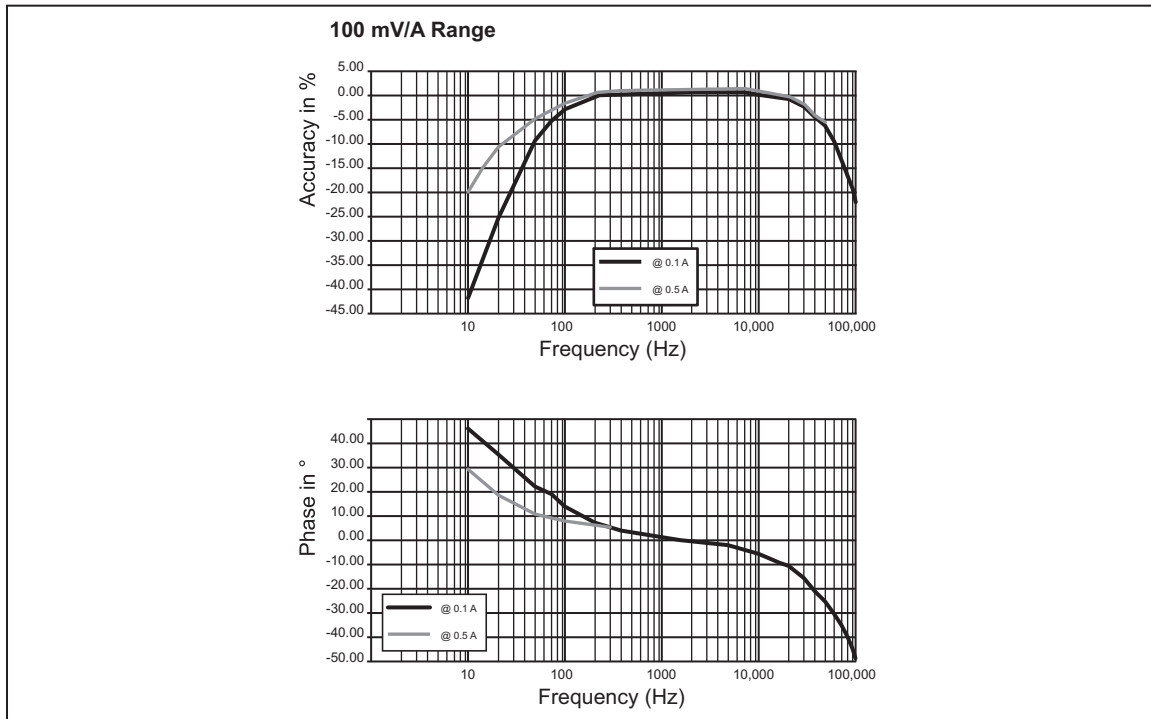


Figure 2. Typical Response Curves (cont)

akp09f.eps

Performance Tests

⚠ Warning

To avoid electric shock or personal injury:

- Do not perform the following procedures unless qualified to do so. Some procedures involve the use of high current.
- Before handling the test connections and between tests, make sure the calibrator is in standby mode (STBY).
- Review the "Precautions and Safety Information" section before performing the performance tests or calibration.

The following performance tests verify the Current Clamp's specifications and verify its operation. If the Current Clamp fails any part of the performance test, calibration adjustment and/or repair is indicated.

Repairs or servicing not explained in this manual should be performed only at a Fluke Service Center. A Current Probe under warranty will be promptly repaired or replaced (at Fluke's discretion) and returned at no charge. See the registration card for warranty terms. If the warranty has lapsed, the meter will be repaired and returned for a fixed fee. To locate a Fluke service center, refer to the "Contacting Fluke" section.

Required Equipment

To execute the performance tests and/or adjust the calibration, the following test equipment will be necessary. If the recommended model is not available, use test equipment that meets the same specifications.

Table 4. Required Equipment

Instrument Type	Recommended Model	Required Characteristics
DC/AC Voltage Calibrator	Fluke Model 5520A Calibrator or equivalent	Specifications: 0.33 A to 1.09999 A 0.05 % + 100 μ A 1.1 A to 2.99999 A 0.06 % + 100 μ A 3 A to 10.9999 A 0.06 % + 2000 μ A 11A to 20.5 A 0.12 % + 5000 μ A
Digital Multimeter	Keysight 3458A or equivalent	DC voltage range: 10 V dc 14 ppm
Phasemeter	Clark-Hess instrument model 6000 or equivalent	Accuracy ± 50 m $^{\circ}$
50-turn Current Coil	Fluke Model 5500A/COIL	45 Hz to 65 Hz 0.28 % + 0.09 A
Magnet Wire Coil 1 turn of #10 single film coated wire	–	–
Small insulated Phillips screwdriver	–	–
BNC to banana plug adapter	–	–

Phase Shift Test

To check the Phase Shift performance:

1. Set up the equipment as shown in Figure 3.
2. Set the calibrator output to 1 V (phase meter reference input). 1 A and 50 Hz. See Step 1 in Table 5.
3. Verify that the phase reading on the meter is within the limits.

Table 5. Verification Table

Step	Coil	Range	5520A Output	5500A Coil I. Prim.	Freq.	i1000s mV Output		Phase in Deg.	
						Min.	Max.	Min.	Max.
1	50 turn	1 mV/A	1 A	50.0 A	50 Hz	48.5	51.5	-3.0	3.0
2	50 turn	1 mV/A	2 A	100 A	400 Hz	98.0	102.0	N/A	N/A
3	50 turn	1 mV/A	4 A	200 A	60 Hz	197.0	203.0	-2.0	2.0
4	50 turn ^[1]	1 mV/A	14 A	700 A	50 Hz	692.0	708.0	-2.0	2.0
5	1 turn	10 mV/A	5 A	N/A	50 Hz	44.0	56.0	-15.0	15.0
6	50 turn	10 mV/A	0.4 A	20 A	50 Hz	191.0	209.0	-10.0	10.0
7	50 turn	10 mV/A	2 A	100 A	50 Hz	975.0	1025.0	-10.0	10.0
8	1 turn	100 mV/A	0.50 A	N/A	50 Hz	38.5	61.5	N/A	N/A
9	1 turn	100 mV/A	2.00 A	N/A	50 Hz	184.0	216.0	-15.0	15.0
10	1 turn	100 mV/A	10 A	N/A	50 Hz	960.0	1040.0	-15.0	15.0

[1] 700 A/ 50 Hz in 1 mV/A range has a TUR of 3.3

4. Continue to use 1 V as the phase meter reference input, set the calibrator output for the remaining steps in Table 5. Step 2 and Step 8 do not require the phase test.
5. Verify that the phase meter readings meet the phase limits for each step.

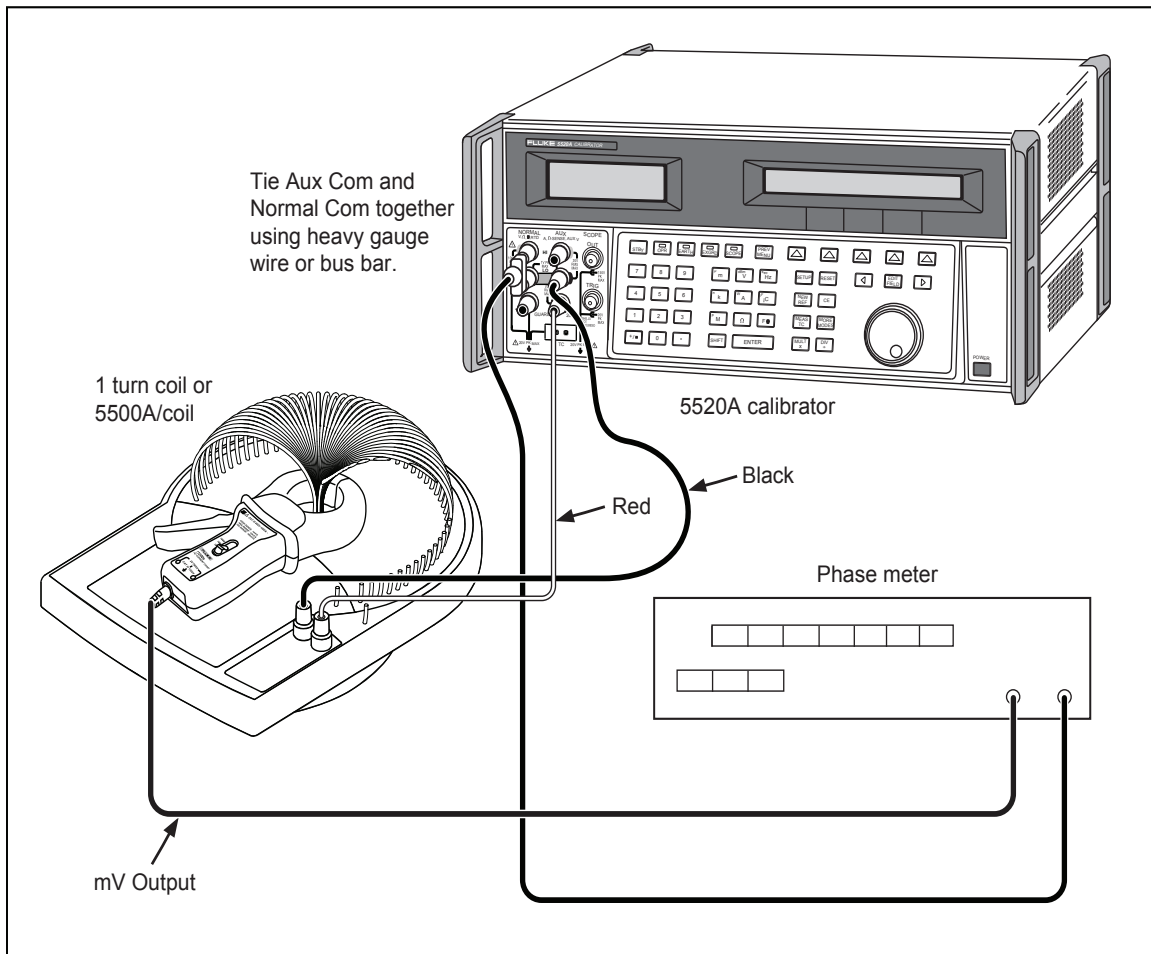


Figure 3. Phase Check Setup

akp03f.eps

mV Output Test

1. Connect the equipment. See Figure 5.
2. Set the calibrator output and coil for each step in Table 5.
3. Verify that the voltmeter reading is within the mV output limits.

Calibration Adjustment

⚠ Warning

To avoid electric shock or personal injury:

- Do not perform the following procedures unless qualified to do so. Some procedures involve the use of high current.
- Before handling the test connections and between tests, make sure the calibrator is in standby mode (STBY).
- Review the "Precautions and Safety Information" section before performing the performance tests or calibration.

Calibration Adjustment Procedure

If the Current Probe fails any of the performance tests, a qualified technician should adjust the probe's calibration. The recommended calibration cycle is 1 year.

To adjust the Current Probe, it is necessary to access a potentiometer located inside.

To access the calibration potentiometer (refer to Figure 4):

1. Remove the two screws located on the back side of the of the Current Probe using a Phillips screwdriver.
2. Separate the two halves of the handle.

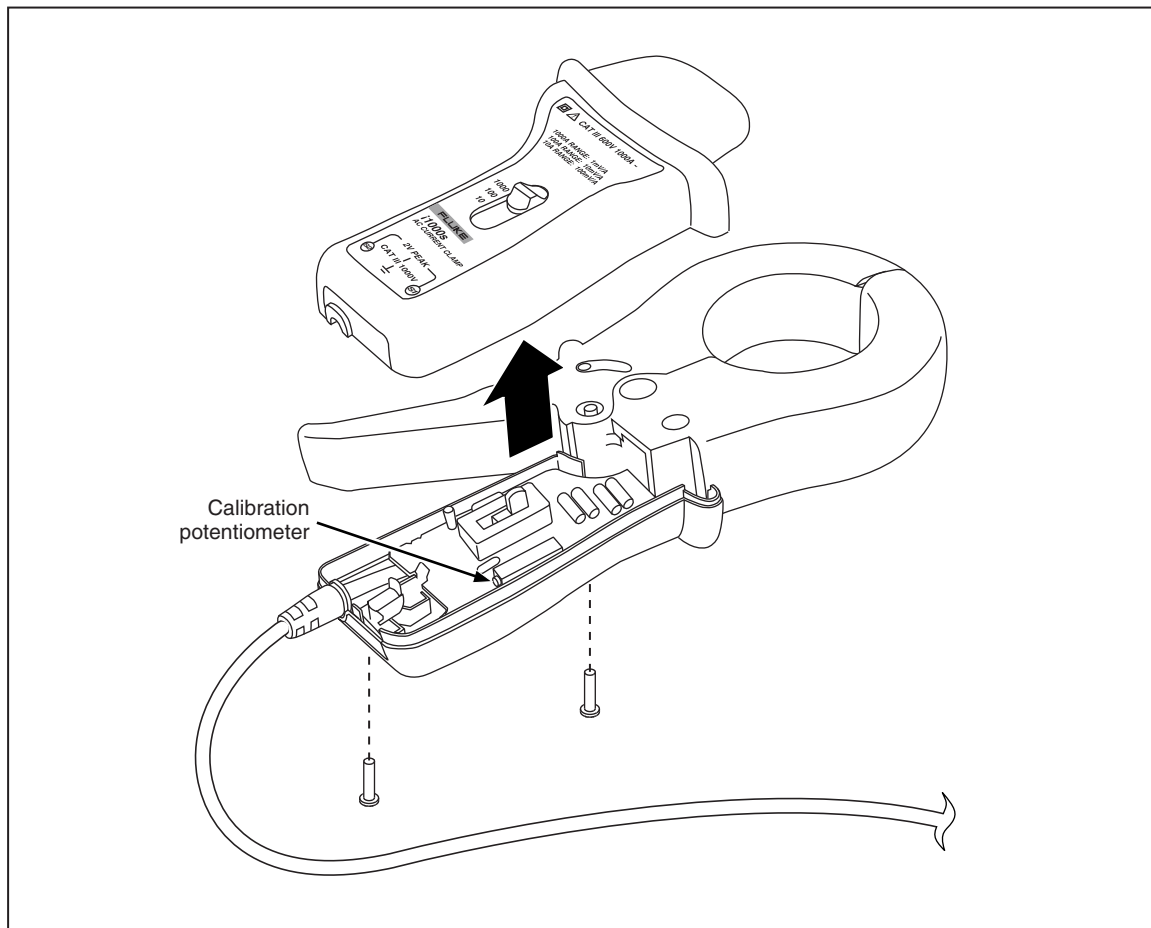


Figure 4. i1000s Disassembly and Calibration Adjustment

akp04f.eps

To adjust the calibration of the AC Current Probe (refer to Figure 4 and 5):

1. Connect the AC Current output of the calibrator to the 50-turn coil.
2. Turn the instruments on and allow a 30-minute warm up period.
3. Connect the Current Probe to the digital multimeter (DMM) input via the BNC adapter.
4. Select the 1 V AC range on the DMM.
5. Select the 1000 A range on the Current Probe.
6. Set the Calibrator to output 10 A @ 50 Hz into the 50 turn coil, thus producing 500 A turns.
7. With the DMM in the 1 V AC range and the Current Probe centered on the coil, adjust the potentiometer to read 0.500V +/- 1 mV.
8. Put the calibrator into standby mode.

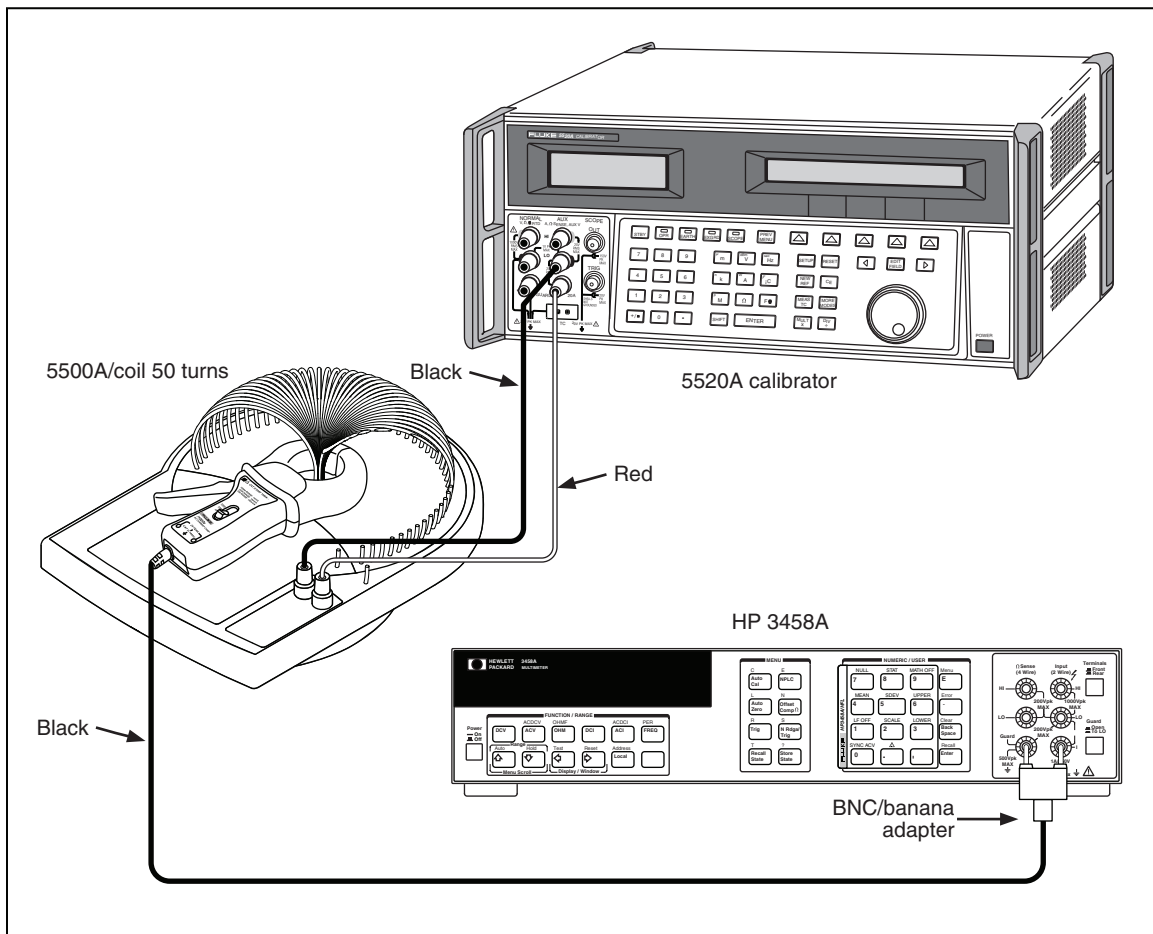


Figure 5. Calibration and Verification Setup

akp02f.eps

