Signet 2759 pH/ORP Simulator and System Tester

3-2759.090 Rev. D 8/05

English

- 1. Description
- 2. Specifications
- 3. Troubleshooting ProcessPro, ProPoint and Intelek-Pro
- 4. Troubleshooting 2750 pH/ORP Electronics
- 5. pH and ORP system response chart

1. Description

The Signet 2759 pH/ORP Simulator is a battery-powered millivolt generator that simulates pH values of 4, 7 and 10, plus ORP values of ±700 mV. This device is useful as a troubleshooting aid and for general verification of system operation. It is not a substitute for periodic system calibration with pH buffers or test solutions. Accessory adapter cables (sold separately) enable the 2759 to connect directly to Signet 2720 preamplifiers or 2750 pH/ORP Sensor Electronics. The adapters include a selector switch for pH or ORP simulation. The switch triggers automatic sensor-recognition software in Signet pH/ORP instrumentation.

Features:

- A. Power OFF button
- B. Output simulation buttons and indicators: Simulate pH and ORP output at five fixed values: pH 4, pH7, pH10, -700 mV and +700 mV. Pressing one of these buttons turns the 2759 on.
- C. Low battery indicator
- D. High Ω switch

Adds 1000 $M\Omega$ resistance in series with output. Simulates high impedance of pH electrodes. Used to verify proper preamplifier operation.


E. 3-2759.393: Adapter cable for use with 2720

F. 3-2759.391: Adapter cable for use with 2750

G. 3-2759.390: Bypass adapter cable (included with 2759)

H. Mode selector switch

Triggers automatic sensor recognition software in Signet pH/ORP instrumentation.

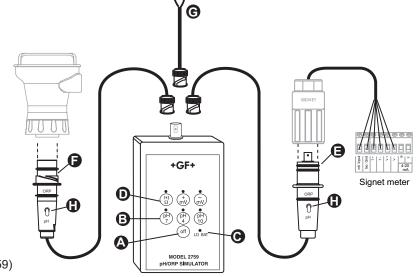

2. Specifications

mV output accuracy: ±0.6 mV (±0.01 pH)

pH system temperature simulation:

w/ 2720 adapter: $3K\Omega = 25^{\circ}C$ ($\pm 4^{\circ}C$) w/2750 adapter $1.1K\Omega = 25^{\circ}C$ ($\pm 4^{\circ}C$)

High Ω resistor value: 1000 MΩ

Battery: 9V alkaline

Life: 400 hours

Dimensions: 100 x 75 x 23 mm


(3.94 x 2.95 x 0.91 in.)

Weight: 120 grams (5 oz.)

mV Value

pH ₄	+177 mV		
pH 7	0 mV		
pH 10	-177 mV		
(E	-700 mV		
(+ mV	+700 mV		

Troubleshooting systems with 2720 Preamplifier

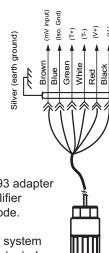

Connecting the 2759 output to the 2759.393 adapter cable then connecting to the 2720 preamplifier simulates the output of the pH/ORP electrode.

This configuration is used to verify general system operation. Every element of the system is tested except the electrode.



- Press any output simulation button to turn the 2759 on.
- · Press OFF button to turn the 2759 off.

Step 1: Routine maintenance and Calibration using buffers

- The most common problem in pH or ORP systems are related to electrode depletion or physical obstruction and fouling.
- Perform routine electrode maintenance, including cleaning and inspection of the electrode, then calibrate the system using buffer solutions. See the electrode and 2720 Preamplifier manuals for more information.

Does the meter respond to buffers correctly?

Yes: Problem resolved by cleaning/calibration.

No: Go to next step.

Step 2: Electrode: Connect 2759 as in "A"

This step requires the 3-2759.393 adapter cable.

- Connect the 2759 to the 2759.393 adapter cable, then insert adapter into 2720 preamplifier.
- Slide the Mode selector switch to the proper position.
- Press output simulation buttons and thenHI Ω button.

(The $HI\Omega$ button must be pressed <u>after</u> each output button.)

See Section 5: Response Chart for proper display

Does the meter read valid temp and pH/ORP?

Yes: The electrode is at fault. Replace the electrode.

No: Go to next step.

Step 3: Verify meter calibration

- Recalibrate the temp, Std and Slope in meter, using 2759 as input.
- Press output simulation buttons.
 See Section 5: Response chart for proper display


Does the meter display valid pH or ORP?

Yes: Problem resolved by meter calibration.

No: Go to next step.

Connecting the 2759 directly to the meter with the 2759.390 Bypass cable simulates the output of the 2720 preamplifier.



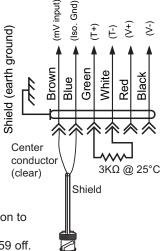

+GF+

+GF+

 Press any output simulation button to turn the 2759 on.

Press OFF button to turn the 2759 off.

Step 4: Check the meter and preamplifier Connect 2759 as in "B"

- Connect the 2759 directly into the meter using the bypass adapter cable.
- Connect a 3K resistor to the temp input of meter.
 (or leave the green and white wires from the 2720 preamplifier connected to the meter.)
- Press output simulation buttons.

Does the meter display a valid temperature (20° to 30°C) and pH/ORP?

Yes: If there are no cable junctions from the preamplifier to the meter, replace the preamplifier. If there are junctions, Go to next step.

No: Problem is in meter. Repair or replace the meter.

Step 5: Check interconnecting cable and junctions

- Connect 2759 and bypass cable at any J-Box or cable splice between the 2720 preamplifier and the meter.
- Press output simulation buttons.
 See Section 5: Response chart for proper display

Does the meter read valid temp and pH/ORP?

Yes: Problem is preamplifier or cable from preamplifier to junction.

No: Problem is in cable.

Check all terminals and splices. Replace cable if necessary.

2

Troubleshooting 2750 pH/ORP systems

Before using the 2759:

- The most common cause of pH/ORP system problems is electrode depletion.
- · Perform routine electrode maintenance, including cleaning and inspection of the electrode, then calibrate the system.
- See the electrode and 2750 Sensor manuals for detailed information.

If the problem persists, or to verify general system operation:

This test procedure requires the 3-2759.391 adapter cable.

Connecting the 2759 output to the 2759.391 adapter cable, then connecting the adapter into the 2750 sensor electronics simulates the output of the 275X pH/ORP electrode.

- Always use the $HI\Omega$ button with the 2759.391adapter cable.
- Connect the 2759 to the 2759.391 adapter cable, then insert adapter into 2750 electronics.
- Monitor the 2750 output using Signet 5091 or other current monitoring device.
- Slide the 2759 Mode selector switch to the proper position. (pH or ORP)
- Press output simulation buttons and then HIΩ button.


(The HI Ω button must be pressed <u>after</u> each output button.)

See Section 5: Response Chart for proper display.

Does the meter read a valid temp and pH/ORP?

Yes: The system is working fine or there is a problem with the electrode. Replace the electrode if necessary.

No: Problem is in 2750 Sensor Electronics. Replace the 2750.

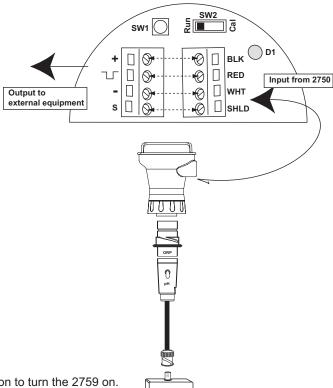

- Press any output simulation button to turn the 2759 on.
- · Press OFF button to turn the 2759 off.

5: pH and ORP System Response Chart

2759 button	pH system re	pH system response*		ORP system response*	
-700mV	2750 current output: 20 5700 pH display: 8750 pH display: 9030 pH display:	mA (max. output) 15 pH 15 pH pH Error	2750 current output: All ORP displays:	5.6 mA -700 mV	
10 pH (-177 mV)	2750 current output:	15.4 mA	2750 current output:	8.4 mA	
	All pH displays:	10 pH	All ORP displays:	-177 mV	
7 pH (0 mV)	2750 current output:	12 mA	2750 current output:	9.3 mA	
	All pH displays:	7 pH	All ORP displays:	0 mV	
4 pH (+177 mV)	2750 current output:	8.6 mA	2750 current output:	10.3 mA	
	All pH displays:	4 pH	All ORP displays:	+177 mV	
+700 mV	2750 current output: 4 i 5700 pH display: 8750 pH display: 9030 pH display:	8750 pH display: 0 pH		13.1 mA +700 mV	

^{* 4-}to-20 mA output values assume factory full span settings:

pH ORP 0 to 14 (+414 mv to -414 mV)

RP -1000 to +2000 mV

Ordering Information

Mfr. Part No. Code Description

3-2759 159 000 762 pH/ORP Simulator/System Tester (includes bypass adapter cable)

Parts and accessories

3-2759.390 159 000 763 Bypass Adapter Cable (included with 2759)

3-2759.391 159 000 764 2750 Adapter Cable 3-2759.393 159 000 765 2720 Adapter Cable



